

MODEL X LATHE


Operator's Manual

This manual was written for the purpose of instructing the operator of a Lodge & Shipley Model X Lathe in the proper care and operation of his machine.

At the time of writing, the manual was completely up-to-date. However, due to continual improvements in design, it is possible that descriptions contained herein may vary slightly from the machine delivered to you. This would imply nothing more than the fact that the machine has been improved to better fulfill your requirements.

THE LODGE & SHIPLEY CO.

CINCINNATI 25, OHIO, U. S. A.

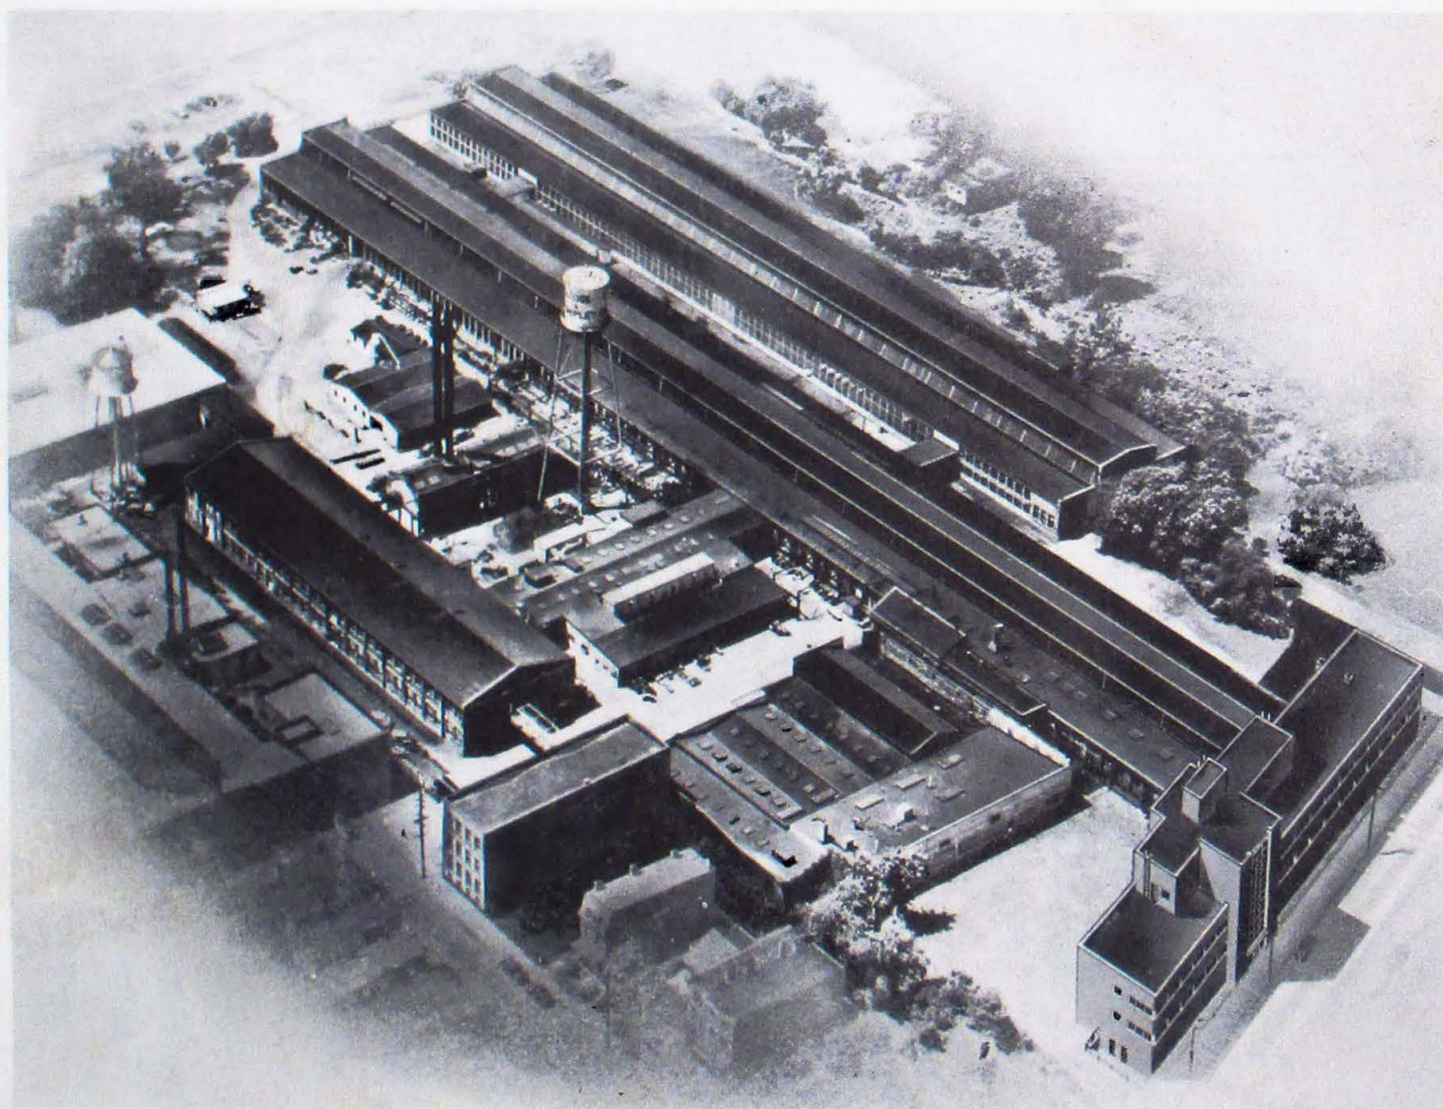

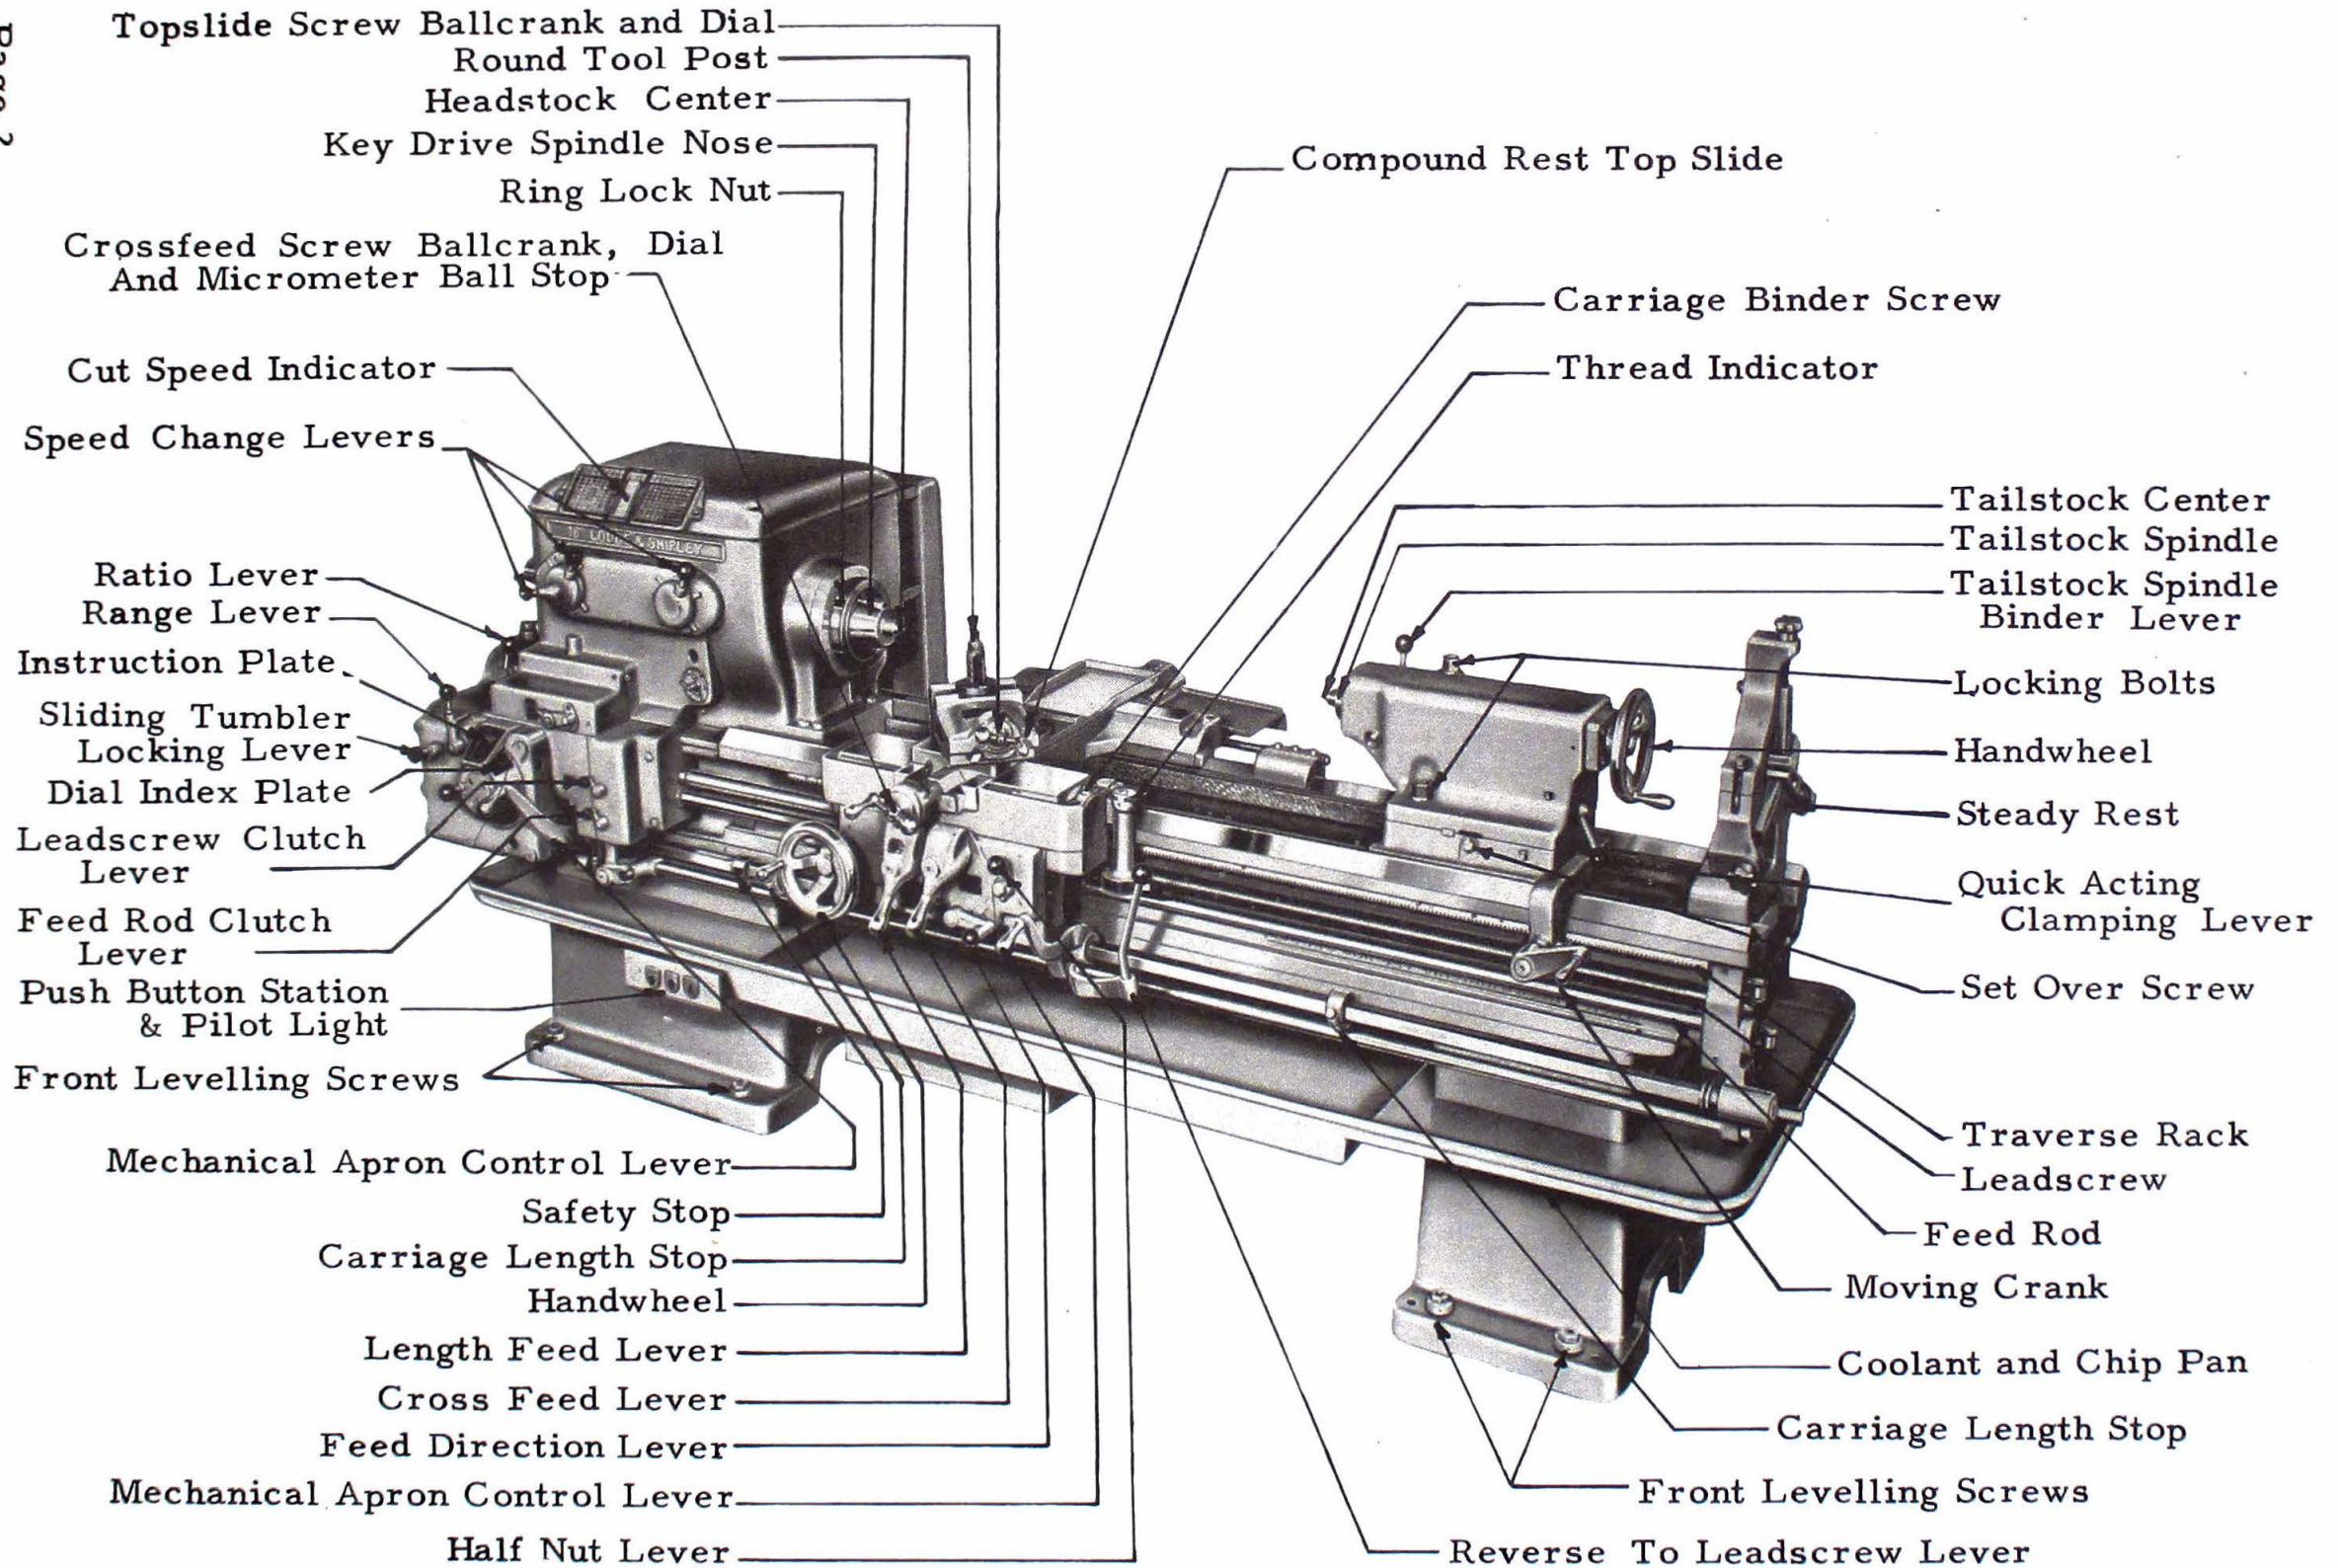


Figure 1. - Model X - 14" Heavy Duty Toolmaker Lathe.

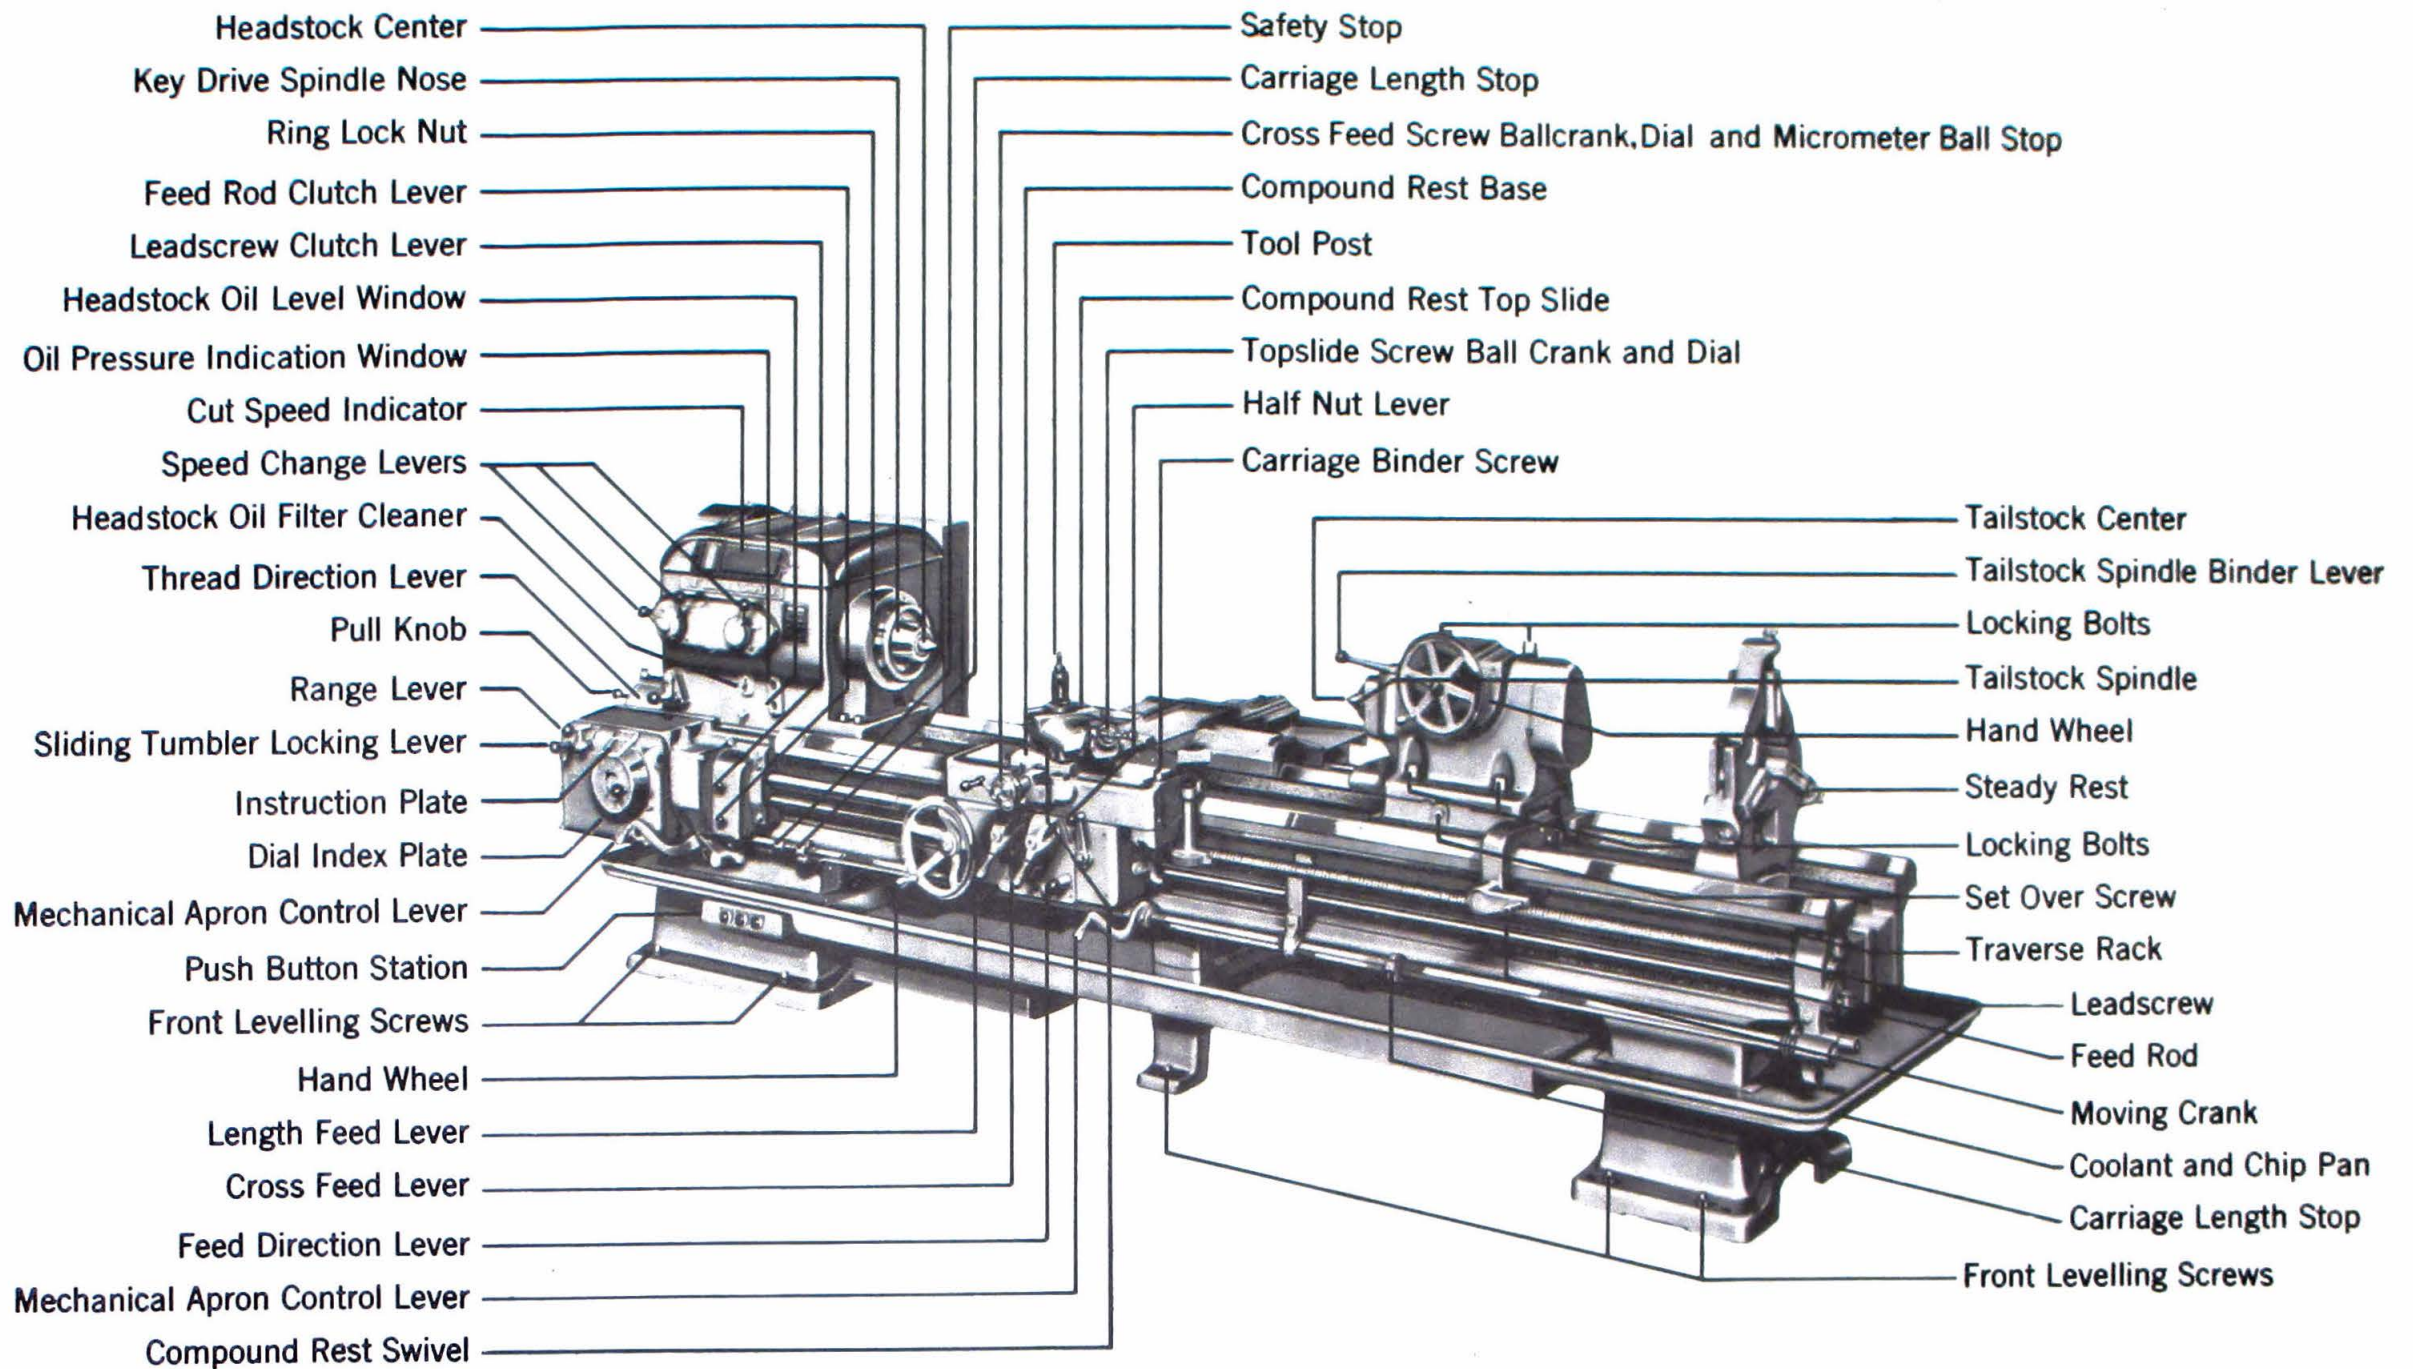


Figure 2 - Model X - 20" Heavy Duty Engine Lathe

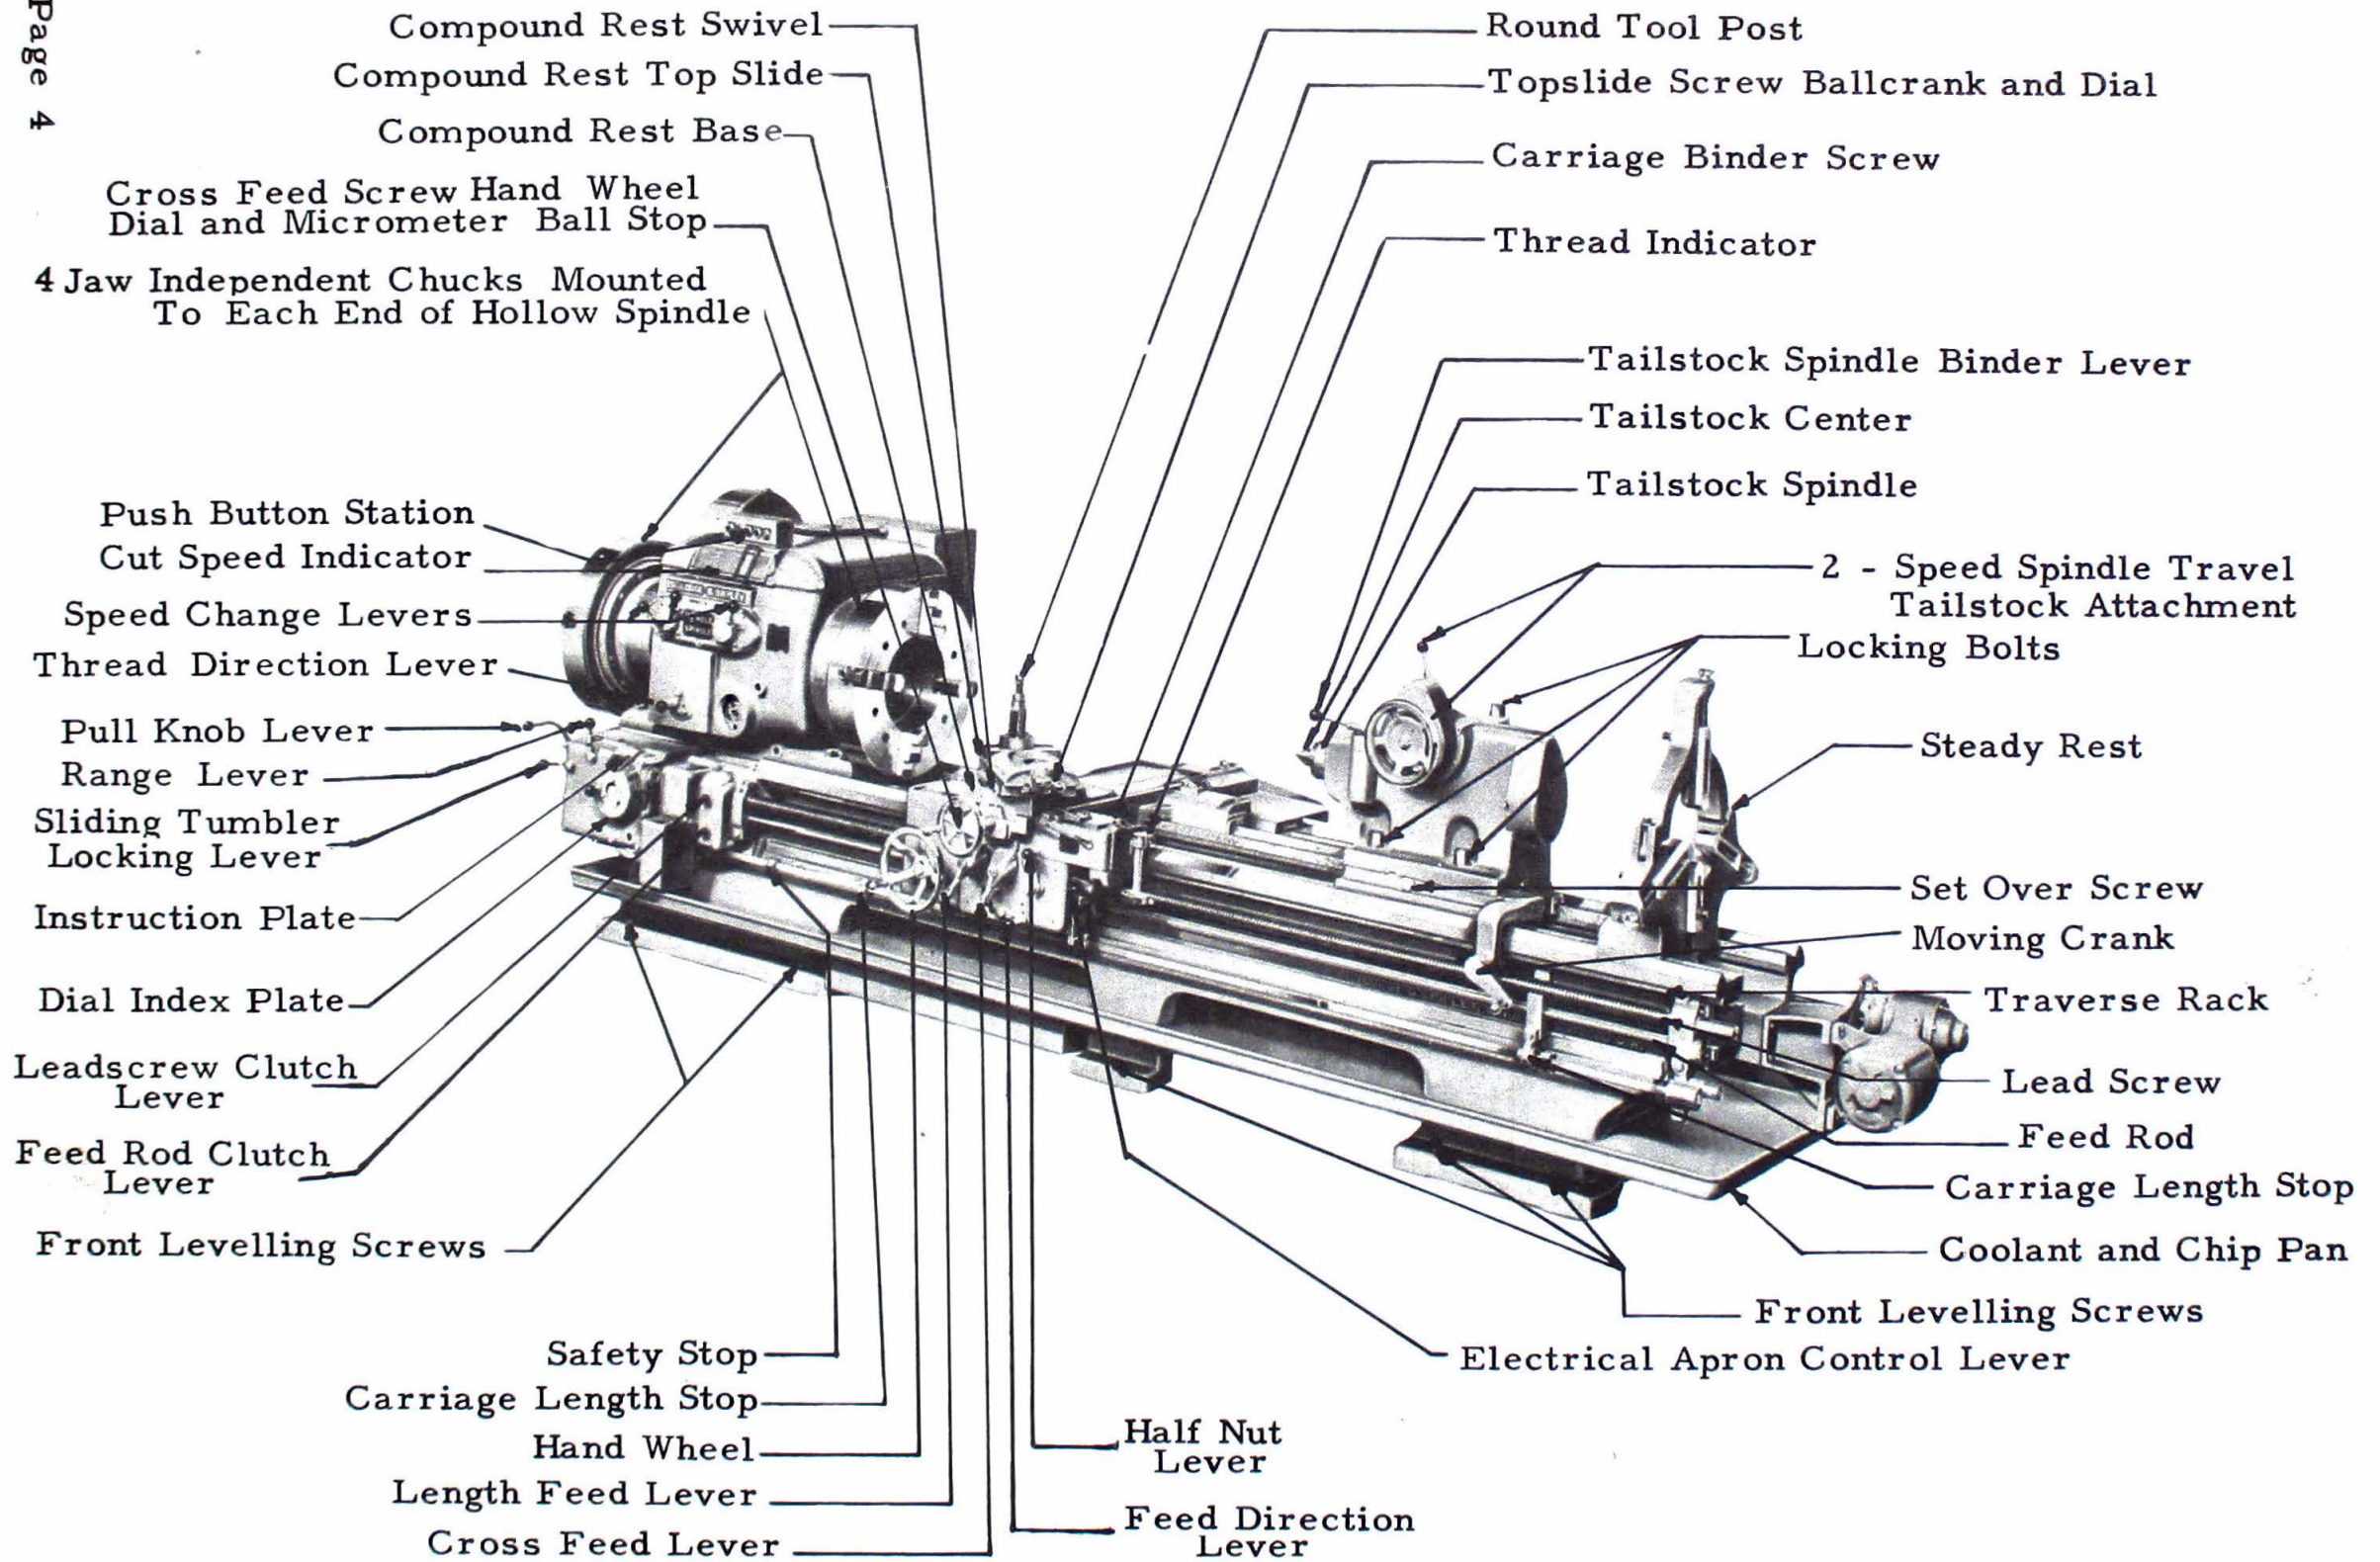


Figure 3. - Model X - 25" Heavy Duty Oil Country Lathe.

CLEANING, ERECTING AND LEVELING

For full and complete information on this subject, see bulletin entitled "Preparing Lodge & Shipley Lathes for Action".

CONNECTING ELECTRICAL EQUIPMENT

After connecting the main line wires, check the direction of pulley rotation with the indicating arrows on the face of the pulley sheave. It is important that the motor run in the proper direction.


LUBRICATION

The importance of proper lubrication cannot be over emphasized. The continued accuracy and long life of the machine depends largely upon proper lubrication at all times; so do not neglect lubrication after the machine has been installed. Lubrication of the lathe should start as soon as it has been cleaned and before any of the mechanisms are operated or any sliding units are moved. A complete lubrication chart will be found on pages 6 and 7. Refer to it frequently and follow the instructions carefully. It is very important that you use only the grades of oil which meet the specifications given, and it is certainly false economy to use any but the highest quality lubricants. The following paragraphs present a general description of the various lubrication systems.


The headstock lubrication system for the Model X 14" and 16" Heavy Duty and the 20" Standard Lathes is shown in Fig. 4. It is a forced system which operates by the action of the centrifugal pump shown, pumping the oil from a separate reservoir below and to the rear of the headstock, through a Cuno oil filter at the front of the headstock and then to the oil-distributor troughs over the top of the bearings and gearing. The oil drains from the moving parts to the bottom of the headstock and then returns to the reservoir. The headstock lubrication system for the 20" Heavy Duty Lathes and larger and the 25" Standard and Heavy Duty Oil Country Lathes is quite similar except the bottom of the headstock casting is used as the oil reservoir instead of the separate reservoir toward the rear.

The Cuno oil filter is incorporated in the system to insure the distribution of clean oil at all times. The handle of the filter should be turned frequently to clear the filter plates and allow the sludge to drop into the small reservoir immediately below the filter. The filter element should be removed and cleaned and the sludge drained by removing the plug at the bottom of the reservoir whenever the headstock reservoir is drained. If at any time the plug is removed from the reservoir and no oil starts to drain out immediately, it is certain that sludge has accumulated and should be cleaned out.


LUBRICATING INSTRUCTIONS AND SPECIFICATIONS

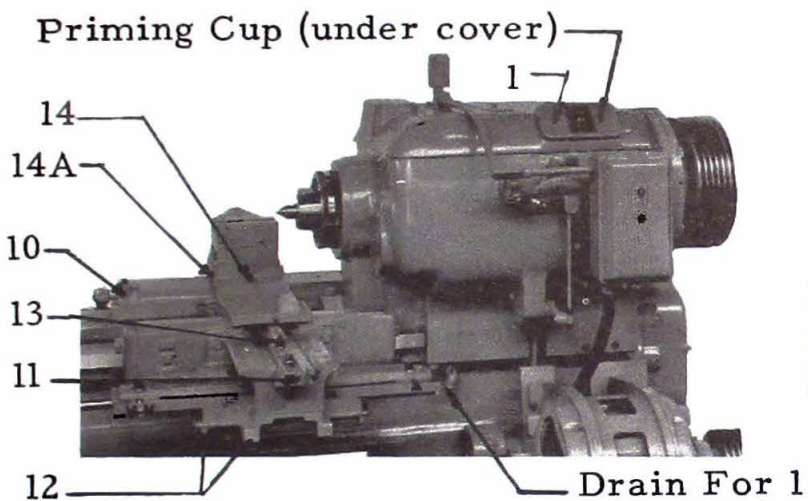


REAR VIEW - MODEL X
 20" HD AND LARGER

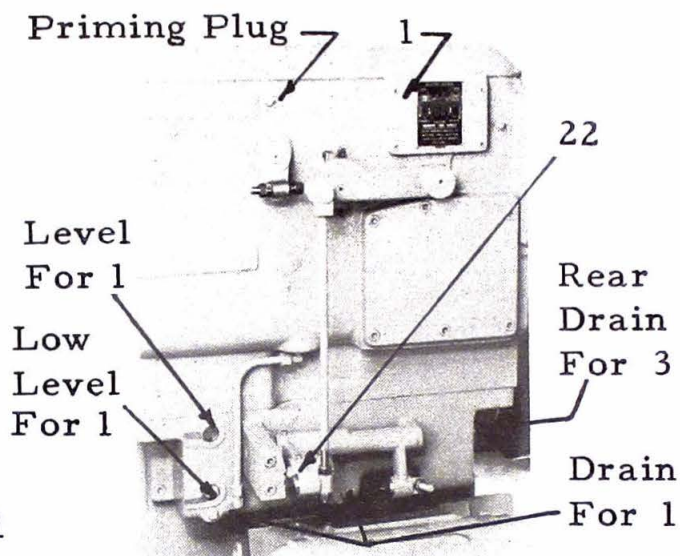

REAR VIEW - MODEL X
 14", 16" & 20" STD.

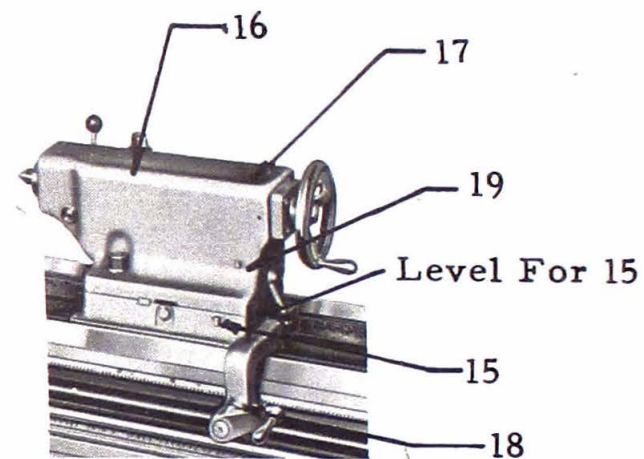

TAILSTOCK MODEL X
 14", 16" & 20" STD.

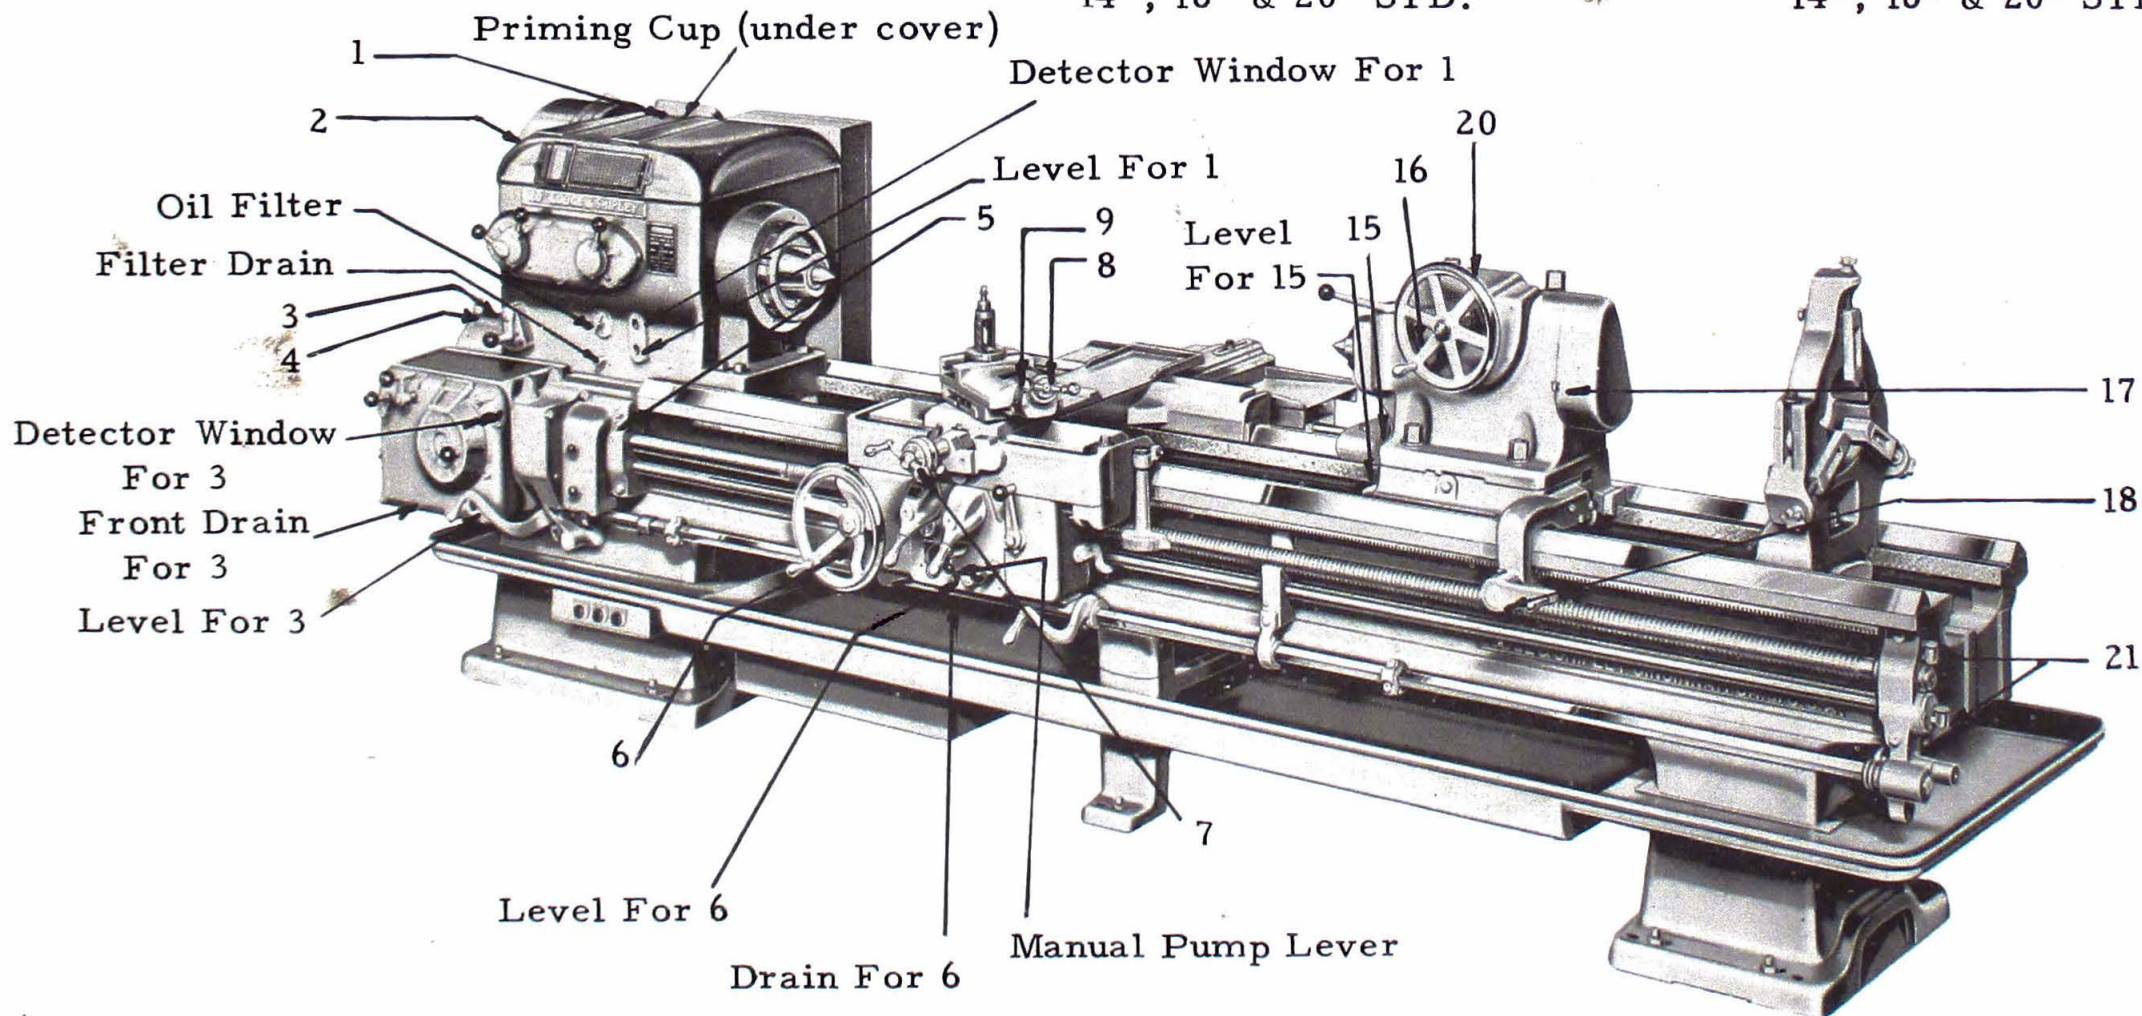

FRONT VIEW - MODEL X LATHE

LUBRICATING INSTRUCTIONS AND SPECIFICATIONS

WHEN TO OIL	STATION NUMBER	PARTS LUBRICATED	INSTRUCTIONS	SPECIFICATIONS
6 Months	1	Headstock Gearing and Bearings and Pulley Gearing	Drain and refill every 6 months. Maintain level with machine idle. Drain sludge from filter. 3 Gal. - - 14", 16" HD & 20" Std. 4 1/2 Gal. - 20" HD 4 Gal. - 25" Std. 5 1/2 Gal. - 25" HD 3 1/2 Gal. - 32" Std. 8 Gal. - 25" Std., 8 7/8" HS 3 Gal. - 25" HD., 11 1/2" HS	Highly Refined Mineral Oil entirely free from acids and alkali and possessing high oxidation stability and film strength. Viscosity: 150-275 Sec. Saybolt at 100° F.
6 Months	3	Quick Change Gearing and Bearings, and End Gearing and Bearings	Drain and refill every 6 months. Maintain level 1 Qt. - 14", 16" HD & 20" Std. 3 Qt. - 20", 25" HD & 25", 32" Std. 25" Std. 8 7/8" HS, 25" HD. 11 1/2" HS	
Daily	4	Quadrant End Gearing	Oil with a Squirt Can	
Daily	5 (20" H. D. and larger Engine, Toolmaker and Oil Country Lathes)	Leadscrew and Feed Rod Forward Bearings	Oil with a Squirt Can	
Daily	16, 17, 18, 19, 21 & 22	Miscellaneous	Oil with a Squirt Can	
Daily	20 (2-Speed Tailstock)	Bearings for Counter and Reduction Unit	Oil with a Squirt Can	
When Required	6	Apron Gears & Bearings, Bedways & Cross Slide Ways	1/2 Pt. 14", 16" HD & 20" Std. 3/4 Pt. 20", 25" HD & 25" & 32" Std. 3/4 Pt. 25" Std. 8 7/8" HS, 3/4 Pt. 25" HD 11 1/2" HS	Special extreme pressure noncorrosive Way Oil containing a sulphur base and a tacky additive. Viscosity: 300-350 Sec. Saybolt at 100° F. Examples: Sun Oil Co. Way Lubricant (P-47) Socony-Vacuum Oil Co. Vactra #2.
When Required	15	Inner Bedways for Tailstock	Maintain level. 1/4 Pt. required	
Daily	7, 8, 9, 10, 11, 12 & 13	Miscellaneous Carriage and Taper Attachment Bearing	Oil with a Squirt Can	
Weekly	2 (Now lubricated for life)	Pulley Bearing	Apply two or three shots with Grease Gun	
Weekly	14-A (14", 16", 20" Std.) 14 (20" H. D. and larger Engine, Toolmaker and Oil Country Lathes)	Cross Feed Screw and Nuts	Apply two or three shots with Grease Gun	
Weekly	16 (B. B. Tailstock Center)	Screw Threads and Ball Bearings for Center	Apply grease with Grease Gun until old grease is forced out around center.	Good quality Ball and Roller Bearing Grease of permanent composition. Viscosity: 60-100 Sec. Saybolt at 210° F.

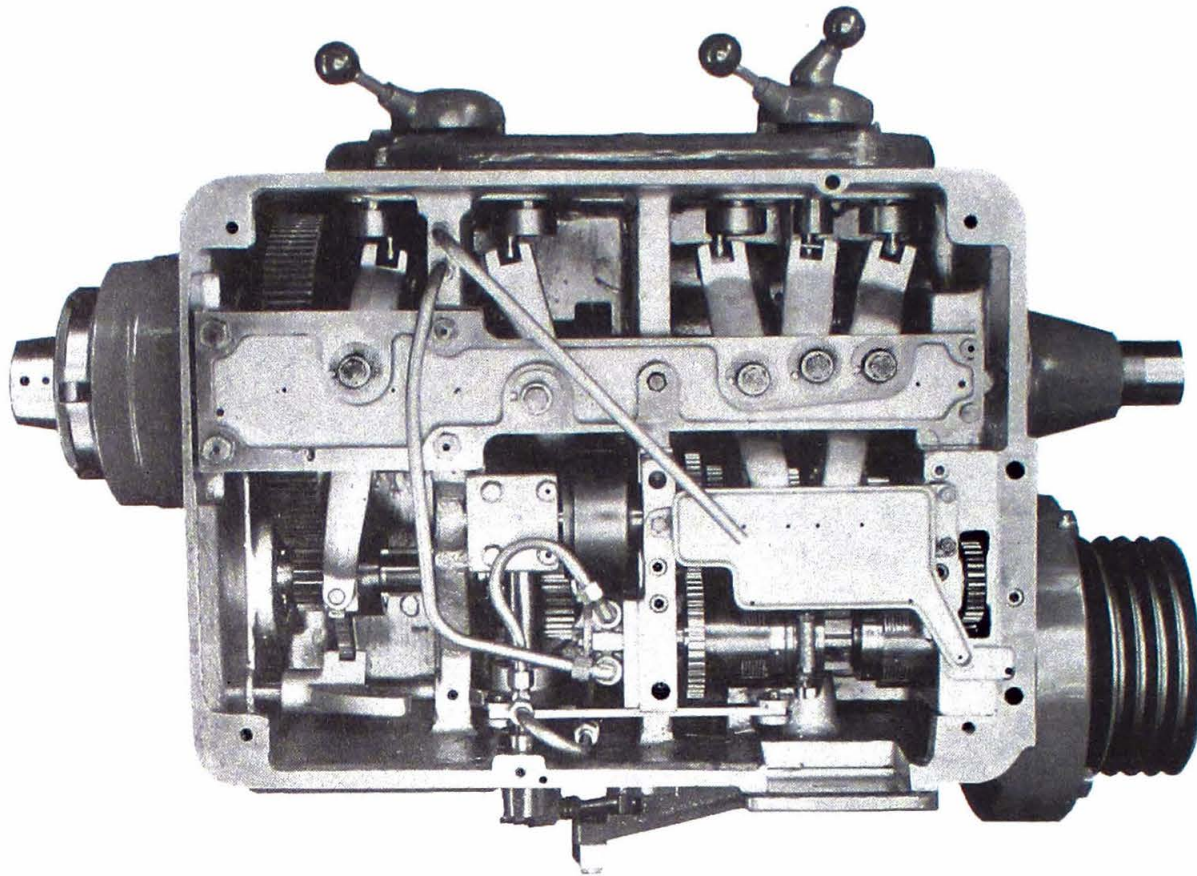


Figure 4 - Model X - 14" 16" H.D. and 20" Std. Headstock with Cover Removed

Oil should always be seen splashing against the detector window at the front of the headstock whenever the motor is driving the pulley. If no flow of oil is visible, the pump is not operating and it should be checked immediately. It should be remembered that the pump will not operate if the pulley is being driven in the wrong direction. If all the oil has drained out of the pump it may be necessary to prime it first to get started. Check the lubrication chart on pages 6 and 7 for the location of the priming plug or cup to use for pouring oil into the pump.

The oil in the headstock reservoir should be drained occasionally and replaced with clean, fresh oil. The frequency depends upon how much the lathe is being used, but good average recommendations are included in the lubrication chart.

It should be carefully noted that two oil level windows, a low level and a high level, are provided at the rear of the headstock oil reservoir of the 14" and 16" Heavy Duty and the 20" Standard Lathes. When the headstock is initially filled with oil, it should be filled up to the high level and then operated for a short period until the pump has had a chance to circulate the oil through the entire system. The headstock should then be stopped and the oil given a chance to drain back into the reservoir as much as it will. Some of the oil will remain

in the headstock itself, particularly in the lower recess housing the feed drive gears. More oil should then be added until the high level is once again reached. Whenever the headstock is stopped afterward, the high level will be maintained. The low level window simply indicates the level at which the reservoir should immediately be refilled.

Only one oil level window is provided for the headstock of the 20" Heavy Duty Lathes and larger and the 25" Standard and Heavy Duty Oil Country Lathes and it is located at the front of the headstock under the detector window. The level determined by the initial filling will be very nearly maintained whenever the headstock is stopped. More oil, of course, should be added as required.

All of the aprons and carriages are also provided with automatic lubrication. A plunger type pump is mounted in the apron and automatically operated by either the longitudinal or cross feed. It supplies oil from the apron reservoir to the gears and bearings in the apron, to the bedways, and to the compound rest bottom slide. The pump may be operated by hand to supply oil to the bedways before moving the carriage, by means of the manual pump lever directly below the clutch levers on the front of the apron. Shear wipers are provided at each end of the carriage bearings. The shear wipers should be removed, cleaned and replaced periodically. In replacing them, care should be exercised to be sure they are bearing on the bedway for their full width.

The tailstock bases of all sizes of Model X Lathes include oil reservoirs and wicking to automatically lubricate the bedways. Shear wipers are also provided for the ways at each end of the tailstock to clean the ways as the tailstock is moved along the bed. These shear wipers should also be removed, cleaned and replaced periodically.

The totally enclosed quick change gear boxes are automatically lubricated by a plunger type pump at the bottom of the box. The pump is operated by a cam which is driven whenever the feed gears are revolving. Oil should be seen splashing against the detector window on the right end of the quick change gear box whenever the thread and feed mechanism is being used. If no flow is visible the pump should be checked immediately. On very fine feeds, however, the flow may not be quite enough to touch the window. The oil is pumped from the reservoir at the bottom of the box to a distributing system at the top of the box. There it is distributed to the quick change gears and bearings as well as to the end gearing bearings and leadscrew and feed rod forward bearings. As indicated on the lubrication chart, the large cup at the top of the end gearing cover is used to supply oil to the wicking which lubricates the quadrant end gears.

TIPS TO INSURE ACCURATE WORK

If difficulty is experienced in maintaining turning, facing and boring operations to within standard limits, the chances are this is caused by the lathe being out of level. Experience gained in hundreds of cases on complaints of this nature enables us to make this statement authoritatively. The first thing to do is to relevel the lathe carefully using a good sensitive machinists' level.

For work held between centers, it is important to make sure that the centers in the work line up with each other. Remember that if a long piece is turned without a steady rest or follow rest, the work itself will spring away from the tool to some extent.

While misalignment may have been caused by rough handling in shipment, these cases are so extremely rare that all other possibilities should be exhausted first before requesting a factory service call. If the lathe chatters, it may be due to one or more of the following causes:

- (1) Machine may not be level; see bulletin entitled "Preparing Lodge & Shipley Lathes for Action".
- (2) One or more of the leveling screws may not be resting solidly on leveling plates; carefully readjust.
- (3) Work may not be well enough supported by extending too far out from chuck; chuck the work shorter or support outer end in a steady rest.
- (4) Work supported between centers may be too long in relation to the diameter; use a steady rest near the middle of the piece when the length is more than about 12 times the diameter.
- (5) Oil, grease, or dirt may be between the bore of the driver and the spindle nose; carefully clean and dry both the bore and the nose.
- (6) Nicks may be in the bore of the driver or on the spindle nose; carefully polish smooth.
- (7) The keyway of the driver may be bearing on the top of the key in the spindle nose; file the keyway for clearance - do not alter the key in the spindle nose.

NOTE: If chucks or other drivers tend to loosen on the nose during operation, points #5, #6, or #7 will undoubtedly be the cause.

- (8) The adapter plate, if used, may be loose against the driver or improperly fit to the spindle nose; alter as required.

- (9) There may be end play in the spindle; see instructions on page 15 for adjusting spindle bearings.
- (10) The cross-slide or top slide gibs may be too loose; readjust carefully - see page 22.
- (11) Cutting edge of tool may be below center line; readjust to bring it on center to 1/32" above center.
- (12) Dirt may have collected between the centers and the workpiece, the tailstock center and spindle bore, the headstock center and collet, or the collet and bore; carefully clean all surfaces.
- (13) Cutting tool may be too weak or may be overhanging the block too far.
- (14) Cutting tool may be loose in the block.
- (15) If using a tool holder with an inserted bit, the bit may be loose.
- (16) If using an unbalanced driving fixture or machining an unbalanced workpiece, the machine may vibrate; counterbalance with weights on the light side of the spindle.
- (17) The cutting speeds and feeds may be incorrect; get proper recommendations and reset machine.
- (18) Foundation may not be rigid enough to isolate vibration from adjacent machines.

HEADSTOCK

Figure 4 shows the top view of Model X 16" Heavy Duty Lathe headstock with the cover removed. Except for the notable differences mentioned below, it may be considered typical of the Lathes. Note that 24 forward speeds and 16 reverse speeds are obtained by shifting spur gears along hardened splined shafts by three levers at the front of the headstock. In order to change the speeds, the levers are moved to the locations indicated on the index plate for the desired speed.

NOTE: Do not shift the gears before stopping the spindle.

If the levers do not move readily to engage the selected speed, engage the friction clutch slightly to move the gears a small amount. A neutral position (lettered "N") is included in order to make it possible to rotate the spindle by hand for adjusting chuck jaws, etc.

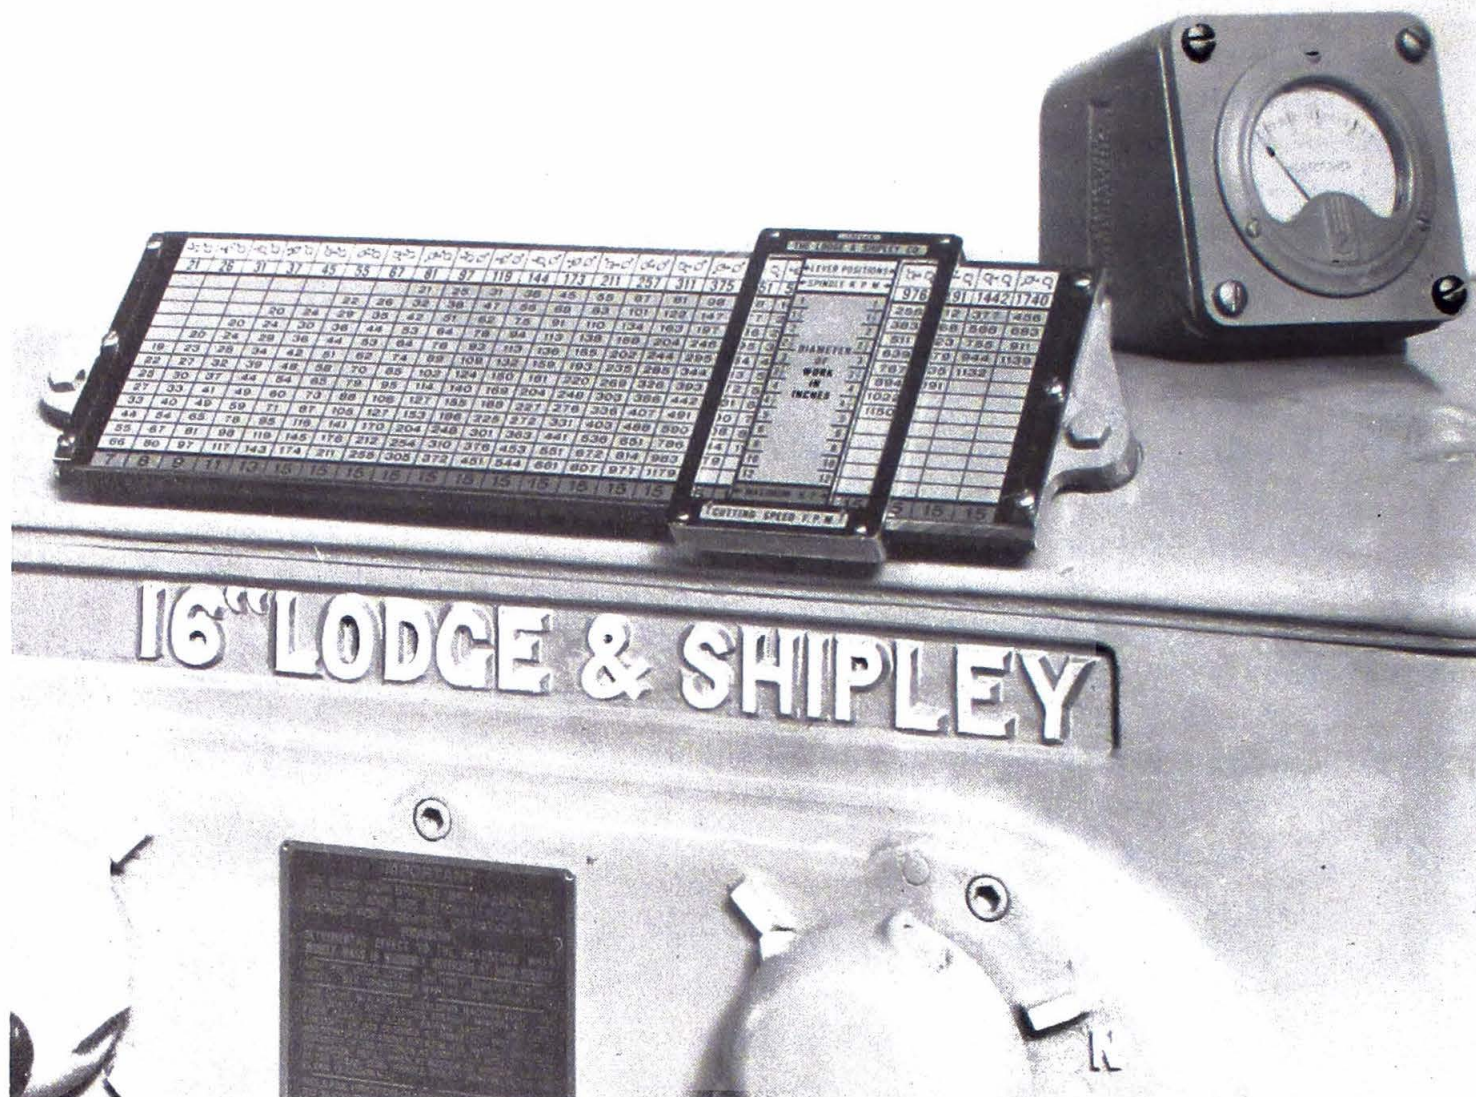


Figure 5 - Maximum Horsepower and Cut Speed Indicator with Ammeter

The standard Slide Rule Type Spindle Speed Index Plate and Maximum Horsepower and Cut Speed Indicator along with an Ammeter calibrated in horsepower (optional at additional cost) are shown in Figure 5. The standard speed range for the 14" Heavy Duty Model X Lathe is 14 to 1160 R.P.M. with a maximum allowable horsepower of 10. That range and power is also the same for the 16" Heavy Duty and the 20" Standard machines and all three sizes also have optional intermediate ranges of 21 to 1740 R.P.M. with a maximum of 15 horsepower and high ranges of 24 to 2000 R.P.M. with a maximum of 20 horsepower. The standard speed range for the 20" Heavy Duty and the 25" Standard machines is 9 to 500 R.P.M. with a maximum of 20 horsepower and the high range is 13 1/2 to 750 R.P.M. with a maximum of 30 horsepower. The standard speed range for the 25" Heavy Duty and the 32" Standard Lathes is 7 1/2 to 422 R.P.M. with a maximum of 25 horsepower and the high range is 9 to 507 R.P.M. with a maximum of 30 horsepower. A low speed range from 6 to 338 R.P.M. with a maximum of 20 horsepower can also be supplied. The standard speed range for the 25" Standard Oil Country Lathe is 8 to 451 R.P.M. with a maximum of 20 horsepower and the low speed range is 6 to 338 R.P.M. with a maximum of 15 horsepower. The standard speed range for the 25" Heavy Duty Oil Country Lathe is 6 to 338 R.P.M. with a maximum of 20 horsepower.

In every speed range of sizes 14", 16", 20" HD, 20" and 25" Standard Model X Lathes, the highest eight spindle speeds are interlocked to prevent reversing of the spindle. Note from Figure 4 that whenever the high speed spindle gear is being driven, the interlock hook is in position to prevent the reverse clutch from being engaged. Reversing at the high speeds without allowing the spindle to stop completely would be detrimental to the gearing. On Lathe sizes 25" Heavy Duty and larger, an electrical reverse to the motor is furnished when ordered. A centrifugal interlock (zero switch) is provided on these lathes to prevent reversing the motor until motor RPM is approximately 50. When reversing is ordered on these lathes, the same range of spindle speeds available in the forward direction is also available in reverse.

The five shifter levers which pivot from the oil distributor trough are accurately set at the factory for full engagement of the gears. If however, for any reason, it becomes necessary to reposition the travel of the gears for proper meshing, eccentric bushings are provided at the pivots for making such an adjustment. It is then necessary to remove the pins, rotate the bushings for a suitable adjustment and repin.

The Cut Speed Indicator should be used by moving the slider until the largest diameter (inches; if metric-millimeters) of the workpiece to be machined (set up in either the right or left column) is in index with the suitable surface speed (ft./min.; if metric, meters/min.) to be used for the job. At that point the proper R.P.M. and lever setting will appear at the top of the slot being used in the slider and the maximum allowable horsepower for that R.P.M. will appear at the bottom. The horsepower shown simply indicates the maximum safe horsepower cut that can be taken at that particular spindle speed. An Ammeter, when used in conjunction with the Cut Speed Indicator, shows the horsepower consumed at any given time or condition of cut. The machine, therefore, should never be operated in such a manner that the Ammeter shows a higher horsepower than the Cut Speed Indicator for that particular spindle speed. On the other hand, in order to protect the motor, the machine should never be operated over a prolonged period with the Ammeter showing a higher horsepower than the rated power of the motor. If desired, the approximate horsepower that will be consumed by any cut may be calculated in advance by the usual formula.

The feeds are driven from the spindle gear inside the headstock near the rear end of the spindle and then, although not completely visible in Figure 4, through a double-ended positive reversing clutch to a gear on the outside of the head which drives the end gearing to the quick-change gear box. The clutch is of the multiple-tooth type for all machines except toolmaker lathes, and is controlled by the thread direction lever at the front of the head stock. For toolmaker lathes, the clutch is of the single-tooth type, since for threading, register between the spindle and leadscrew must be maintained. The clutch is then operated through the mechanical reverse to leadscrew linkage from the apron. The 25" Heavy Duty and the 32" Standard Lathes reverse by shifting a gear instead of a clutch.

HEADSTOCK SPINDLE

The Key Drive Tapered Spindle Nose is standard on all sizes of Model X Lathes (except the Oil Country Lathes). Face plates, chucks, and other types of driving fixtures are made for direct application. When placing chucks or other drivers on the nose, the bore and nose should be thoroughly cleaned and wiped to remove any oil or grease and then the spindle should be rotated to bring the key to the top. This key is designed to support the fixtures and align them with the threaded lock ring.

The Cam Lock Spindle Nose will be furnished optionally at no additional cost instead of the Key Drive Tapered Spindle Nose on all sizes of Model X Lathes from the 14" Heavy Duty through the 25" Standard.

The spindle of the 25" Standard Oil Country Lathe employs the American Standard 15" A-1 spindle nose, while that of the 25" Heavy Duty Oil Country Lathe employs the American Standard 20" A-1 spindle nose. When changing chucks or face plates on the Oil Country Lathes, the bore and nose should be carefully cleaned and wiped to remove any oil or grease and the spindle rotated to bring the driving pin to the proper position to enter the chuck. The chuck should then be bolted tightly against the flange of the nose.

The spindles of the 14" and 16" Heavy Duty and 20" Standard Lathes are supported at the front and center on two opposed tapered roller bearings and at the rear by a double row tapered roller bearing with a floating outer race, as shown in Figure 6. Figure 7 shows the spindle assembly for the 20" Heavy Duty and larger Engine and Toolmaker Lathes in which the rear bearing is the same type as for the smaller sizes to allow free expansion of the spindle and the forward bearings are also two opposed tapered roller bearings but are set closer together than are those in the smaller sizes. Figure 8 shows the spindle assembly for the Large Hole in Spindle Oil Country Lathes.

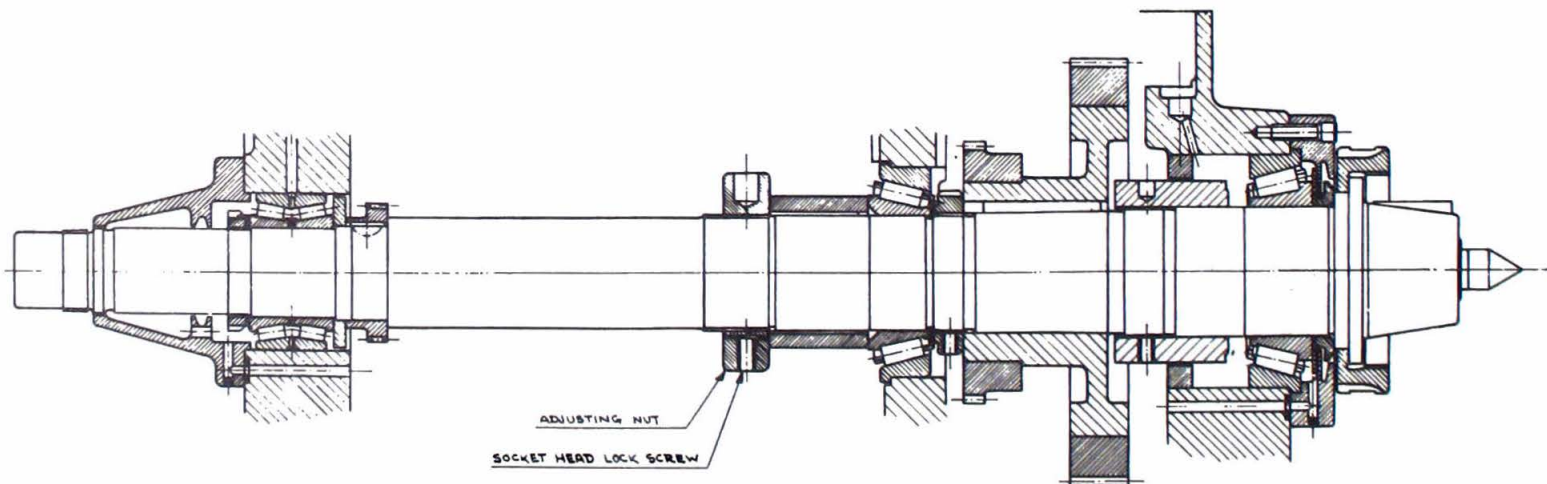


Figure 6 - Spindle Mounting on Model X - 14", 16" H.D. and 20" Standard.

The spindle bearings are carefully adjusted before the lathe is shipped from the factory and unless absolutely necessary this adjustment should not be changed.

To adjust the bearings on the 14" and 16" Heavy Duty and the 20" Standard Lathes, proceed as follows:

Remove the main cover over the top of the headstock and rotate the spindle by hand until the socket head set screw which locks the adjusting nut can be loosened. The screw will be slightly peened over to prevent backing out, but can be broken loose with a good wrench. After releasing the lock screw, tighten the adjusting nut until the front and center tapered roller bearings are free of all end play and when the spindle is turned by hand, there is a very slight drag. Rotate the spindle in alternate directions while tightening the adjusting nut to assure the proper seating of the bearing rolls. Relock the set screw tightly and repeen it; replace the cover; and run the headstock slowly at first and then faster, until the highest speed is reached. Operate at that speed for about an hour. During that period, check the temperature of the bearings several times to see that it does not exceed about 140°F., and also make certain the bearings are not noisy. The rear bearing is set at the factory and will need no further adjusting in the field.

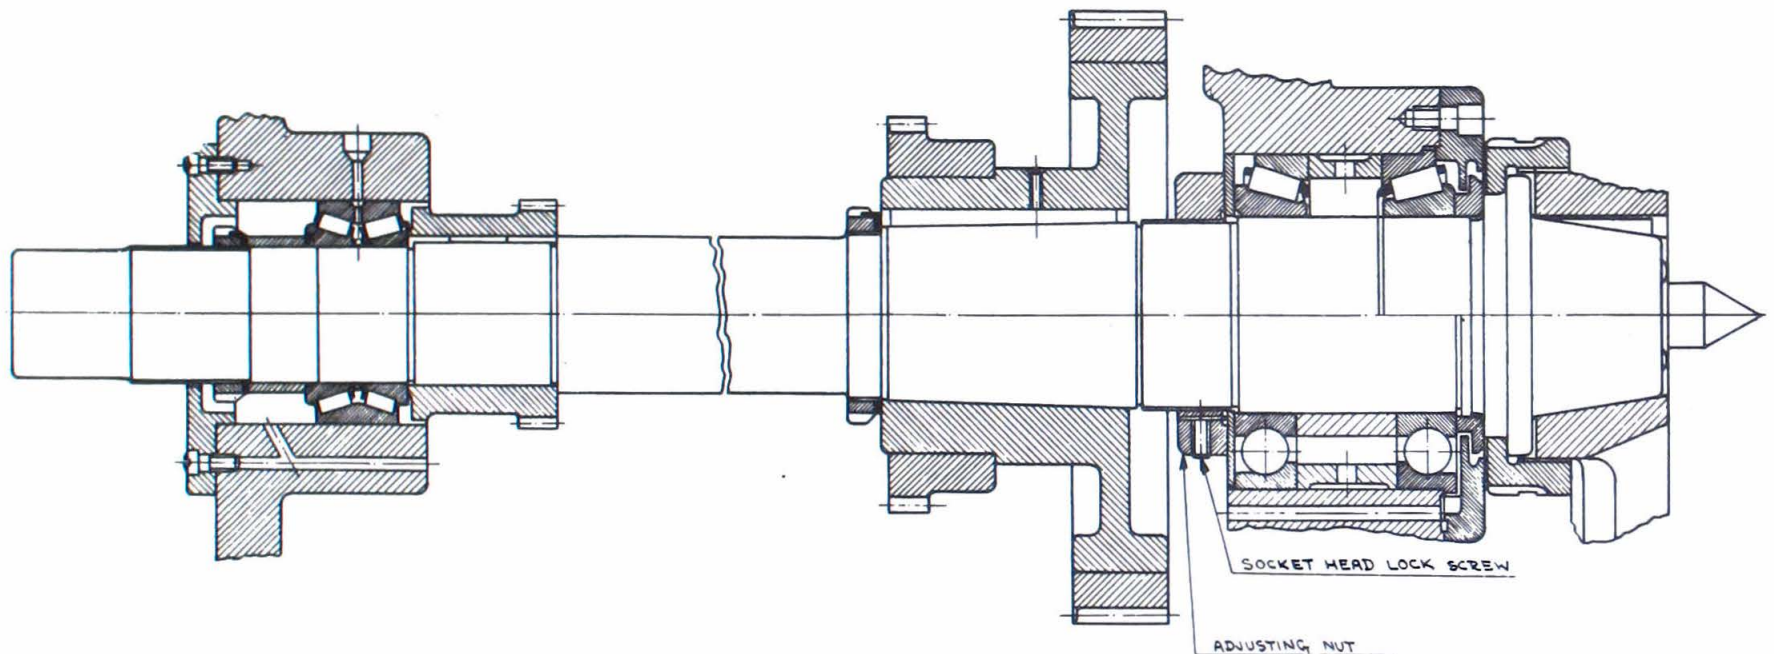


Figure 7 - Spindle Mounting on Model X - 20" H.D. and Larger Engine and Toolmakers Lathes

To adjust the bearings on the 20" Heavy Duty and larger Engine and Toolmaker Lathes proceed as follows:

Remove the main cover over the top of the headstock and rotate the spindle by hand until the socket head set screw which locks the adjusting nut can be loosened. The screw will be slightly peened over to prevent backing out, but can be broken loose with a good wrench. After releasing the lock screw, tighten the adjusting nut until the two front tapered roller bearings are free of all end play and, when the spindle is turned by hand, there is a very slight drag. Rotate the spindle in alternate directions while tightening the adjusting nut to assure the proper seating of the bearing rolls. Relock the set screw tightly and repeen it; replace the cover; and run the headstock slowly at first and then faster, until the highest speed is reached. Operate at that speed for about an hour. During that period, check the temperature of the bearings several times to see that it does not exceed about 140° F., and also make certain the bearings are not noisy. The rear bearing is set at the factory and will need no further adjusting in the field.

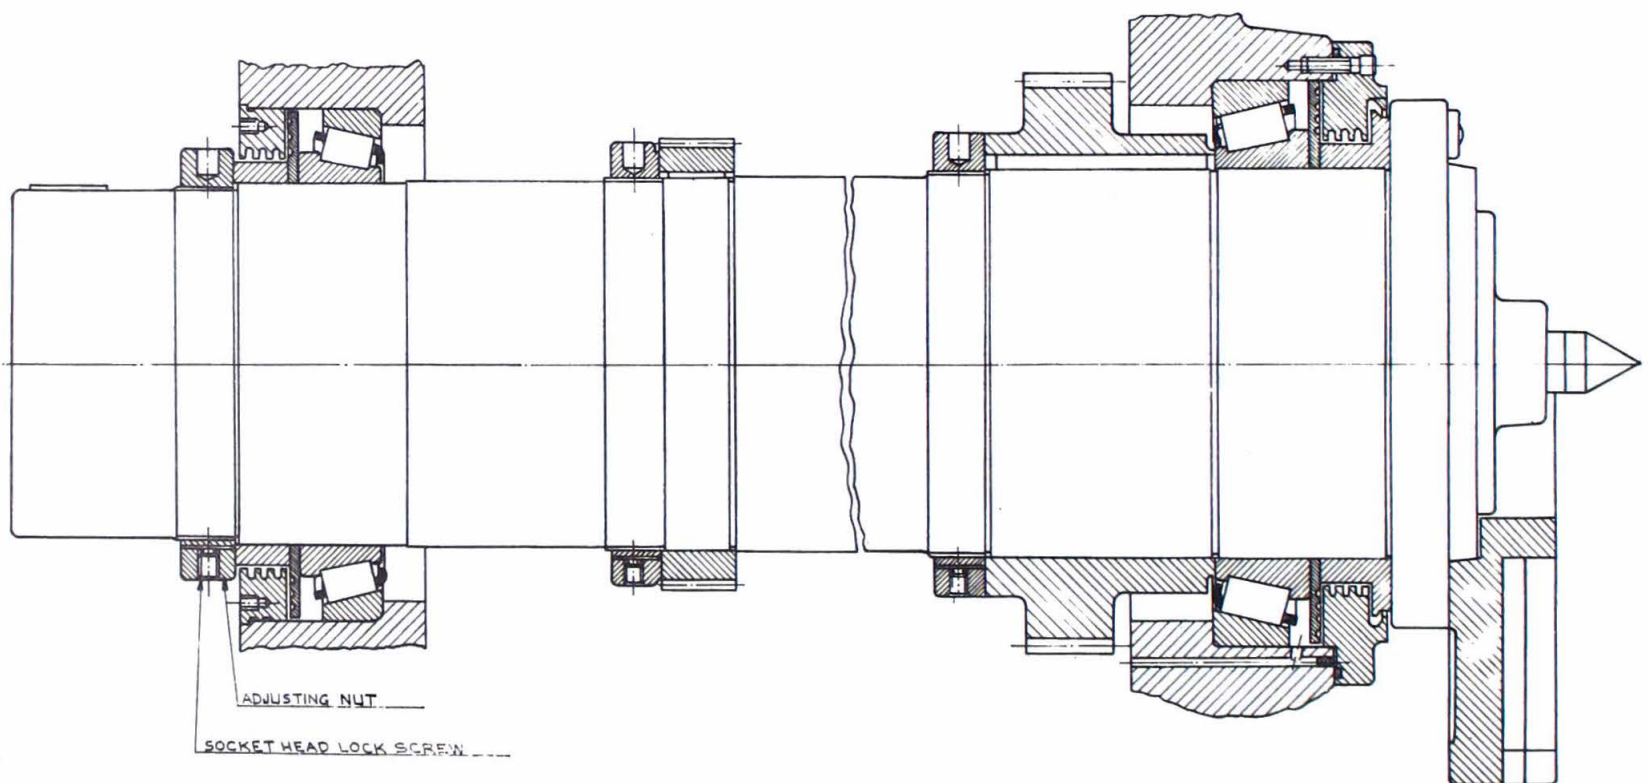


Figure 8 - Spindle Mounting on Model X Oil Country Lathes

To adjust the bearings on the Large Hole in Spindle Oil Country Lathes, proceed as follows:

Rotate the spindle by hand until the socket head set screw which locks the adjusting nut at the rear of the spindle can be loosened. The screw will be slightly peened over to prevent backing out, but can be broken loose with a good wrench. After releasing the lock screw, tighten the adjusting nut until the bearings are free of all end play and, when the spindle is turned by hand, there is a very slight drag. Rotate the spindle in alternate directions while tightening the adjusting nut to assure the proper seating of the bearing rolls. The amount of drag should be checked by inserting two long bolts in diametrically opposite holes in the flange of the spindle nose and rotating the spindle by hand with the two bolts. The proper adjustment is to have the bearings tight enough to allow the spindle to turn for about 1 1/2 revolutions. Relock the set screw tightly, repeen it, and run the headstock slowly at first and then faster, until the highest speed is reached. Operate at that speed for about an hour. During that period, check the temperature of the bearings several times to see that it does not exceed about 140° F., and also make certain the bearings are not noisy.

HEADSTOCK CLUTCHES AND BRAKE-14", 16", 20" Heavy Duty, 20" and 25" Standard

A forward and reverse multiple disc clutch is an integral part of the headstock of the 14", 16", 20" Heavy Duty, 20" and 25" Standard, Model X Lathes and is located on the initial drive shaft as seen in Figure 4. They are interconnected with an efficient cone-type brake which is also built into the headstock and provides braking to the spindle from the forward as well as the reverse spindle rotation.


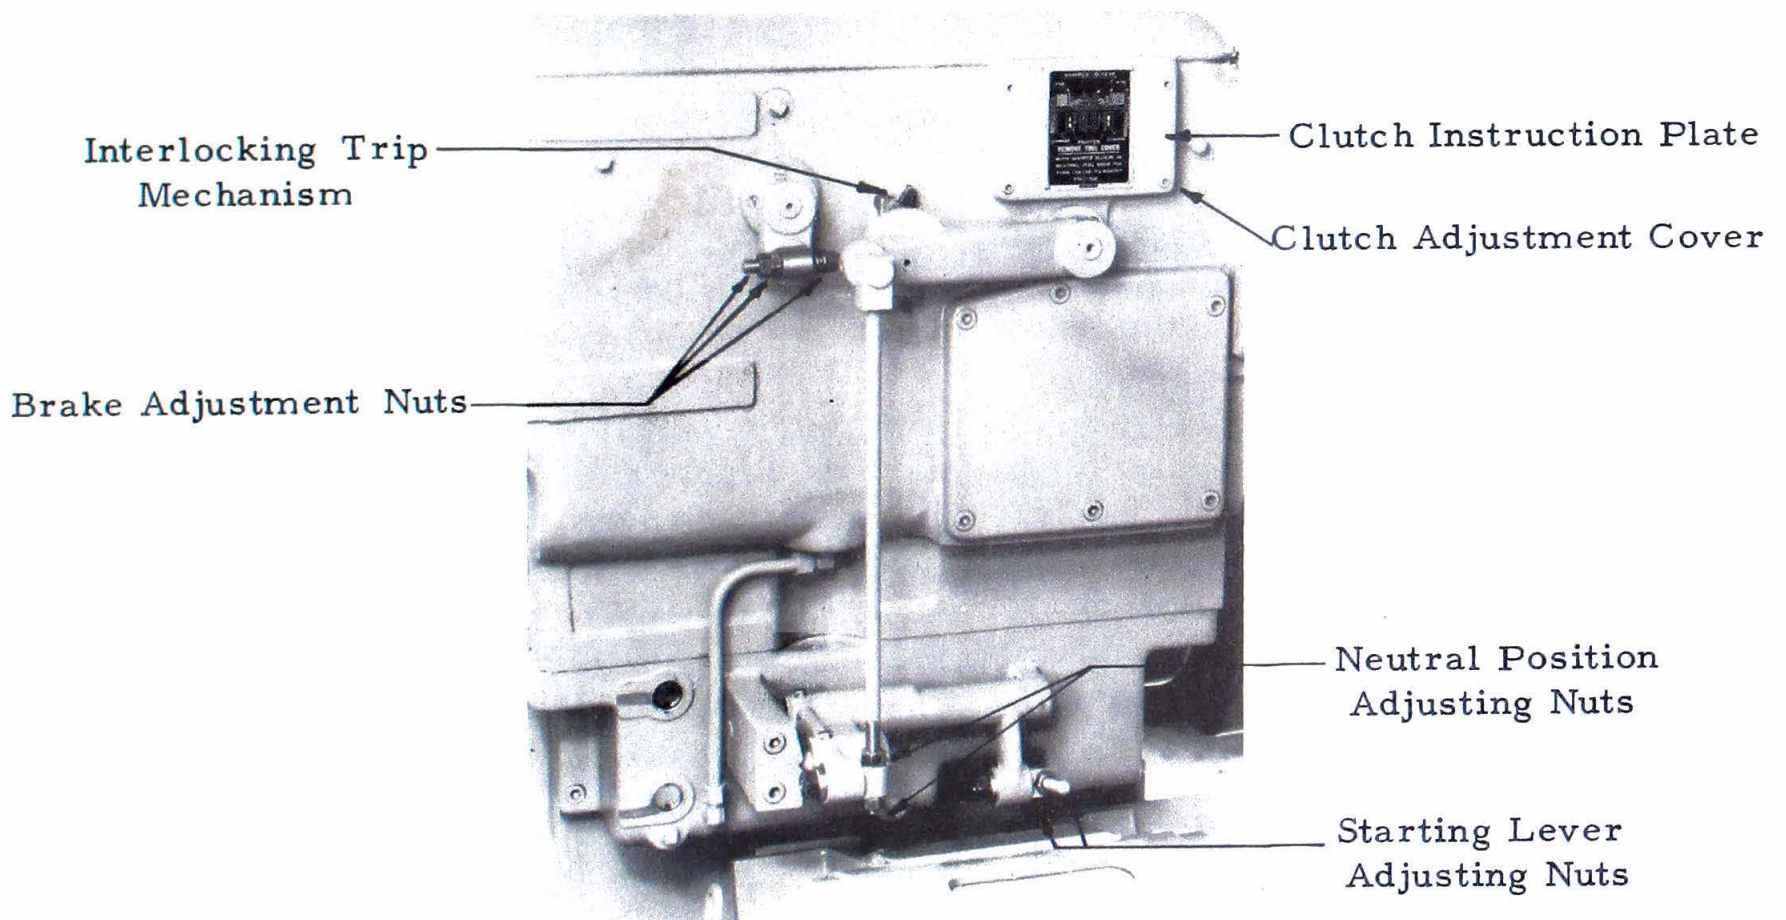


Figure 9 - Rear View of Headstock on Model X -14", 16" H.D., and 20" Standard

The square shaft running along the front of the bed controls the movements of the clutches and brake, and levers at the headstock end and also attached to the apron are used by the operator for rotating the square shaft. The spindle is started turning forward by pulling either lever up as far as it will move; it is stopped by moving it down to the central position. At that point, the forward clutch is disengaged and the brake is applied. An interlocking trip mechanism, which may be seen in Figure 9, at the rear of the headstock prevents moving either starting lever down through the central position from forward into reverse without hesitating in the brake position. This feature eliminates changing rapidly from forward to reverse without application of the brake. To change from forward into reverse, either lever is moved down into the brake position, then lifted slightly to disengage the interlock and then moved downward into the reverse position. To stop, either lever is moved up again to the central brake position.

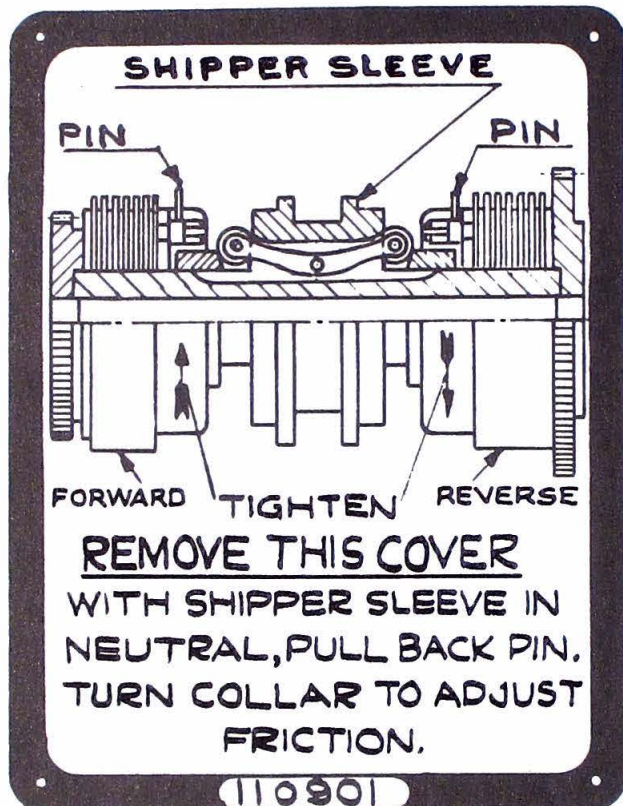

If either the forward or reverse clutch does not pull, heats, or jumps out of engagement, it must be adjusted. To adjust, remove the small cover on which is mounted the instruction plate shown in Fig. 10. With the clutch in neutral, turn it until the adjusting lock pin can be reached. Pull the pin out and turn the adjusting ring as shown in Figure 10 one or two adjusting holes, or until the operating lever requires a distinct pressure to engage. Before starting the lathe, be sure the pin is properly engaged and seated. A new clutch may require several adjustments when first put into operation in order to wear in the plates and action parts. After the initial adjustments, clutches will run for a considerable period without adjustment.

Figure 10 - Clutch Instruction Plate

The cone type brake, which is lined with molded Raybestos, may be adjusted with the locknuts on the brake linkage shown in Figure 9. To increase the braking effect, draw the nut up against the spring when the linkage is in the brake position. The releasing of the brake is adjusted by the nut and locknut opposite the spring. Move the linkage to the brake position and adjust these nuts so that there will be a clearance of .010 to .015 from the square pivot. The brake should always be adjusted to bring the spindle to a slow stop.

The up and down positions of the forward and reverse starting levers may be adjusted by lengthening or shortening the effective length of the horizontal front-to-rear link shown in Figure 9. Changing the length can be accomplished by adjusting the nuts at the back end of the link as required.

HEADSTOCK BRAKE AND REVERSE - 25" Heavy Duty and 32" Standard

The 25" Heavy Duty and 32" Standard Lathes are supplied with an electro magnetic brake and, when ordered, with electrical reversing controls for the main drive motor.

The braking of the spindle is accomplished by an electrically-operated magnetic brake, mounted between the pulley sheave and the frame of the headstock. This efficient magnetic brake provides braking to the spindle from forward, as well as the reverse spindle rotation.

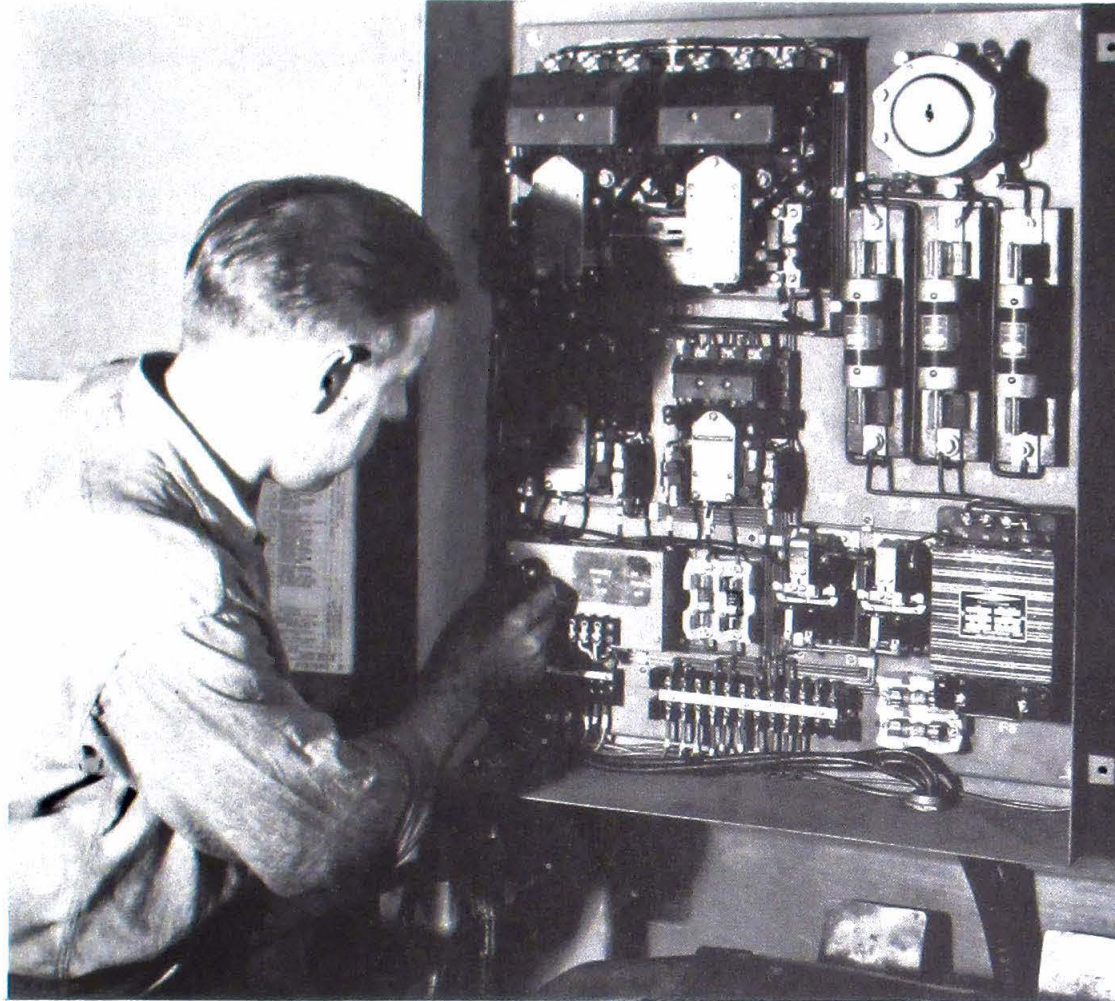


Figure 10-A

The amount of braking torque may be quickly regulated, when necessary, by the small rheostat shown in Figure 10-A. **EXTREME CAUTION** should be exercised in adjusting this rheostat as serious damage to the headstock gearing can result from stopping this spindle too quickly.

Definite rules for adjusting brake torque in the field cannot be given because operating conditions vary with the type of work driver being used, the size and weight of the work piece and the spindle R.P.M. A "Rule of the Thumb" that might be followed in adjusting the brake torque is: First, operate the spindle at one half of its highest R.P.M. Second, assuming that a chuck is used for a work driver, adjust the rheostat to bring the spindle to a stop in seven or eight seconds. Under no circumstances should a stopping time of less than six seconds be used.

The master switch control bar is the square shaft running along the front of the bed. The starting lever on the right side of the apron controls the rotation of the square shaft and thus is used by the operator to control the master switch. The spindle is started turning forward, or

counter clockwise, by pulling the starting lever up as far as it will move. It is stopped by moving it down to the central position. At that point the master switch controlling the forward rotation of the spindle is disengaged and the magnetic brake is applied. To change from forward into reverse, when the machine is so equipped, the starting lever is moved down from the forward position through the central brake position and into the reverse position. To stop, the lever is moved up again to the central brake position.

If the lathe is equipped with reverse spindle speeds, it is also equipped with a zero switch. When the starting lever is moved from the forward position to the reverse position, the zero switch prevents the instantaneous reversal of the direction of the motor. It causes the magnetic brake to stay engaged until the motor has reduced its speed to approximately 50 R.P.M., at which time the contactors for the reverse speed are engaged. This safety feature eliminates any detrimental effect to the headstock or motor by reversing too quickly.

The basic control for setting up the various electrical units of the 25" Heavy Duty and 32" Standard, is centralized in the terminal box on the rear of the headstock. A push button station is conveniently located on top of the headstock. The station includes a start button, a stop button, a red pilot light, and a jog button. When auxiliary equipment is supplied with the machine, additional stations are furnished as required.

The start button energizes the control panel as indicated by the red pilot light. Energizing the panel causes the magnetic brake to be set, provided the starting lever is in neutral and the jog button collar set to "run" and causes the rapid traverse motor to start. When the starting lever is set in the central position, pushing the jog button causes the spindle to move around just a small amount. If the collar around the jog button is set to "jog", the spindle will move around and come to a stop without the brake being applied. When the collar is set to "run", pushing the jog button causes the spindle to move around a small amount and then immediately be braked when the jog button is released. While the collar is set to "jog", the starting lever has no control over the spindle.

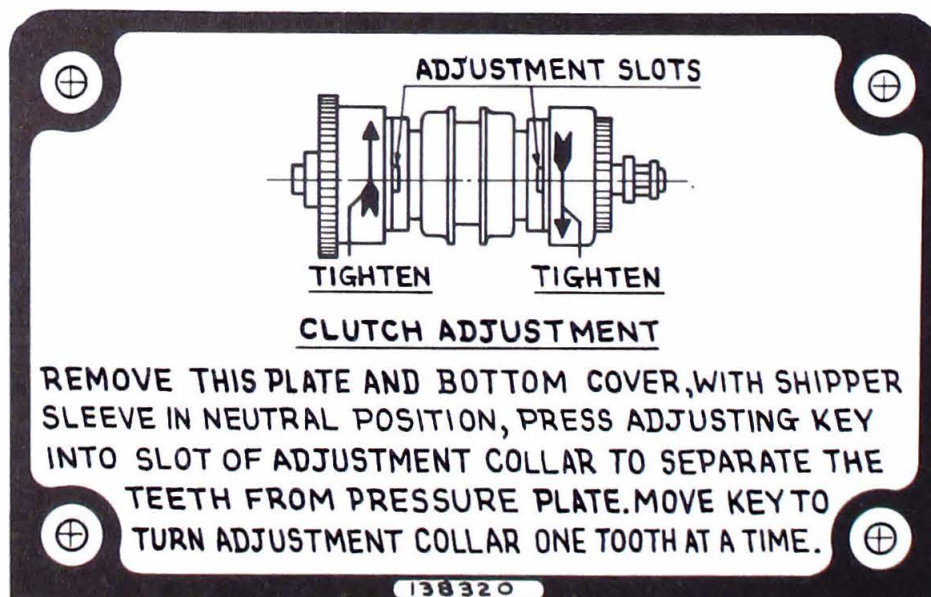


Figure 10-B

POWER RAPID TRAVERSE

The power rapid traverse, standard on the 25" Heavy Duty, 32" Standard and the 25" Heavy Duty 11 1/2" Hollow Spindle Oil Country Lathes, can be supplied on other lathes at extra cost. It is driven by a separate motor which is arranged to run whenever the control panel is energized by pushing the start button on the terminal box. Power is supplied by a gear motor through a right and left hand screw on which are mounted right and left hand nuts. These nuts are carried on the housing attached to the rear of the carriage. By restraining either the right or left hand nut through a multiple disc clutch operated by a lever on the front of the carriage, right or left hand traverse is accomplished.

Adjustment of the power rapid traverse is made by removing the clutch adjustment instruction plate (see Figure 10-B) and the bottom cover of the traverse clutch housing. With the Shipper Sleeve in neutral position, press the adjusting key into a slot of the adjustment collar in order to separate the teeth from the pressure plate. Now move the key to turn the adjustment collar one tooth at a time.

CARRIAGE, COMPOUND REST AND APRON

The carriages of all of the Model X Lathes have both manual and power feeds, as do the cross slides. The compound rest top slide is equipped with hand feed only and may be swiveled on its graduated base to any angle through 360°. Four bolts in the swivel lock the compound rest to the desired angle. Hand traverse of the carriage is operated by the large handwheel on the front of the apron, while hand feed to the cross slide is operated by the ball crank on the cross feed screw and hand feed to the top slide by the ball crank on the top slide screw.

Two levers are conveniently located at the front of the apron for engaging the power feeds. When raised, the left lever engages the cone friction type clutch for feeding the carriage longitudinally, while the right lever engages the feed to the cross slide in a similar manner. Either feed can be disengaged by pushing the lever down all the way. The lever below and to the right of the clutch levers controls the direction of the power feeds and may be placed in forward, neutral, or reverse positions. Note that it affects the direction of rotation of the feed train within the apron and thus reverses both the longitudinal and cross feeds. The lever to the right at the top of the apron engages the half nuts with the lead-screw. An interlock prevents engaging the half nuts without having the feed reverse lever in neutral. When it is in neutral it is impossible to engage the cross or longitudinal feed in either direction.

The standard dials for both the cross slide and top slide are calibrated to indicate .001" (.025 mm., if metric) movement of the slide for each graduation on the dial. When the cross slide dial is used for setting a diameter, therefore, it should be noted that .002" (.050 mm., if metric) will be removed from the diameter for each line passed on the dial.

The micrometer ball stop is provided as a standard feature whenever a standard dial or direct-reading diameter attachment is used, but is omitted when the machine is supplied with multiple diameter stops. It simplifies threading operations by providing an adjustable depth stop on the cross feed screw. It can also be used to advantage as a single diameter stop for turning duplicate diameters.

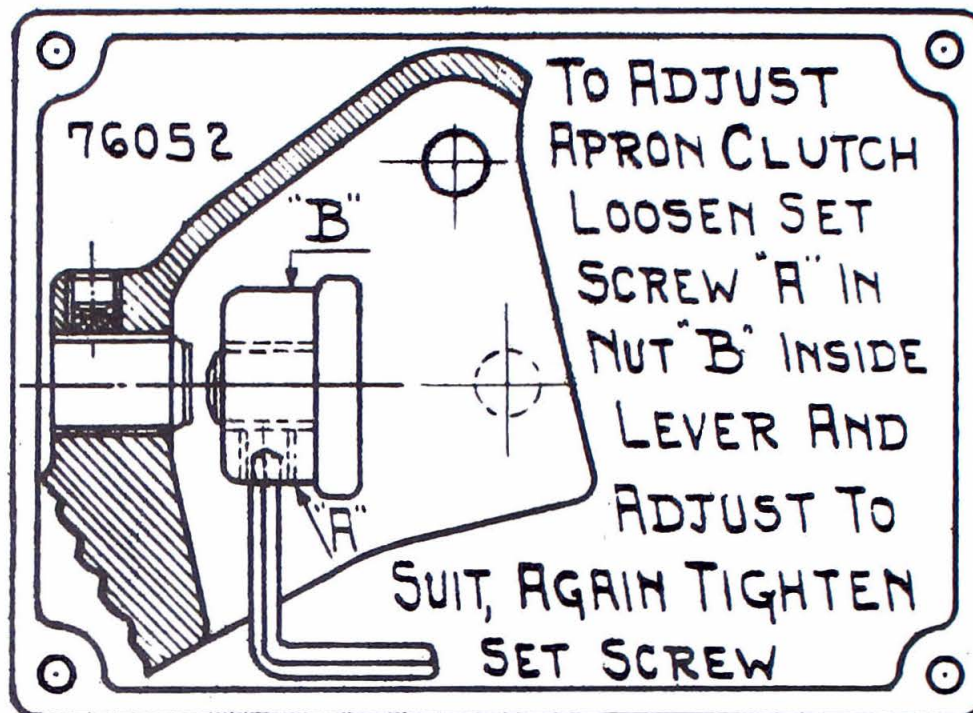


Figure 11 - Feed Clutch Instruction Plate

The ball stop consists simply of a micrometer sleeve which fits in the bore of the front dial bracket, and may either rotate freely when the thumb screw is loose, or be bound to the bracket when the thumb screw is tightened up. The thumb screw exerts pressure through a copper plug and, therefore, may hold the sleeve tightly under high pressure or may allow it to slip somewhat under lower pressure. A steel ball is confined to travel in a straight groove on the inside of the sleeve and in a spiral groove of three turns on the outer diameter of a micrometer bush keyed to the ball crank.

When chasing threads by feeding the tool in on an angle with the top slide, the thumb screw is tightened snugly to form a positive inward stop for the cross slide with the chasing tool set at the thread diameter. The top slide dial is set at zero at that point, and the tool is then advanced inward after each pass with the top slide. The depth is thus easily recorded on the top slide dial. When chasing threads by feeding the tool straight into the work, the above method can be used or the thumb screw can be tightened lightly after the tool is set at the thread diameter and the cross feed dial set at zero. For successive cuts, the stop can be slipped to advance the tool while the dial records the depth. In either case, the ball stop makes it possible to return the tool accurately to the bottom of the last cut by running against the stop. The stop works equally well moving inward or outward, for external or internal work.

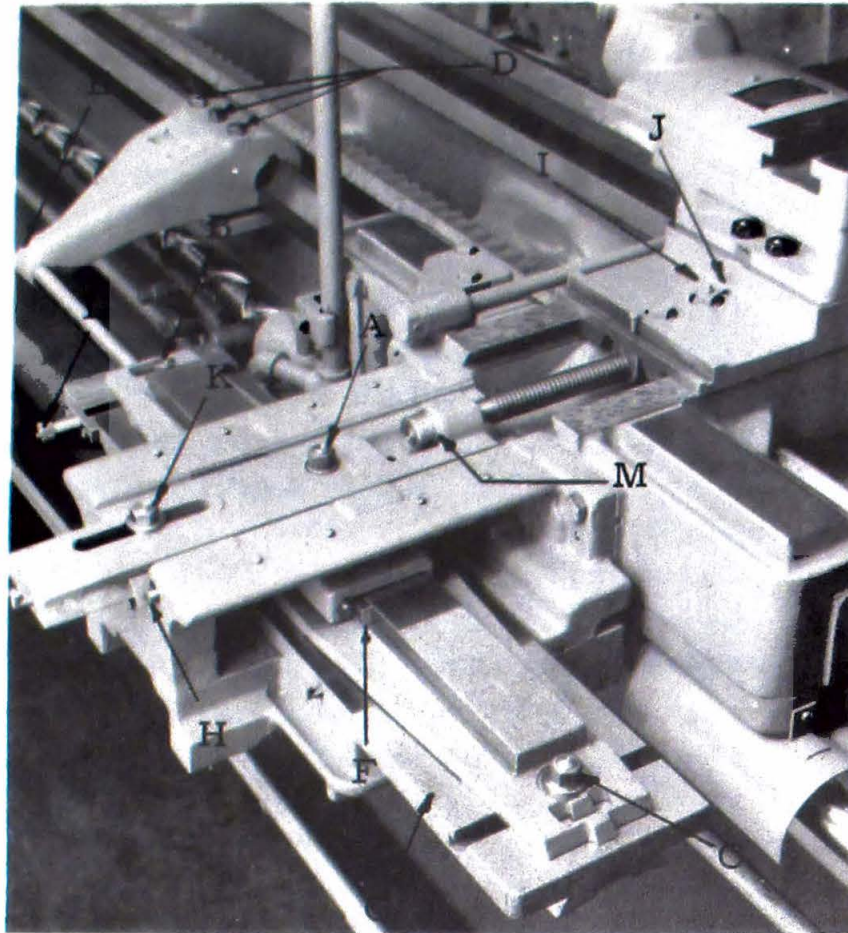


Figure 12 - Carriage and Taper Attachment

The feed clutch levers are initially adjusted at the factory and should normally need little further adjustment in the field. An adjustment may be required, however, after the first few hours of operation. If so, raise the lever to the engaged position and loosen hollow-head set screw "A" in nut "B" inside the lever as shown in Figure 11. Turn nut "B" clockwise to engage the cone more deeply or vice versa and then retighten set screw "A". The adjustment should be made tight enough so that, after the lever is pulled up, it will hold the clutch snugly in engagement.

Carriage gibs are provided for the hold downs on both the front and the back of the carriage on all sizes of lathes. The carriage takes its bearing on the front and rear Vee type bedways of hardened and ground steel. Under extremely heavy cuts, bearing is also taken on the flat tailstock way. The gibs are made in two pieces, each half entering between the carriage and bedway from the ends of the carriage. Each half is adjusted separately by tightening the screw at the outer end of the gib after one or more shims have been removed from the set of shims under the screw head. Removing one shim $1/16$ " thick tightens the adjustment by $.001$ ". The shim arrangement makes it possible to make the proper adjustment and to automatically record that setting. On the 20" Heavy Duty, and larger lathes, an additional clamp and gib is provided under the center flat tailstock way.

In case any backlash develops between the cross feed screw and the nut and compensating nut, it may be eliminated by loosening screw "I" slightly, then tightening screw "J" and retightening screw "I" as shown in Figure 12. By tightening screw "J", the nut and compensating nut are mov-

ed closer together to take up the backlash on the threads. End play in the cross feed screw or any looseness in the ball thrust bearings at the rear of the screw may be taken up by loosening the hollow-head set screw in nut "M", tightening the nut and relocking it with the set screw.

TAPER ATTACHMENT

The taper attachment for all of the Model X Lathes is an extra item and furnished only when ordered. It is a self-contained unit bolted to the back of the carriage and traveling with it. All carriages, however, are machined and jig-drilled for application of the attachment so that it can be ordered at a later date and easily installed.

To set the attachment for any desired taper, loosen nut "A", which holds the guide plate to the sliding shoe, as well as nuts "B" and "C" at the ends of the swivel bar and screw "K" shown in Figure 12. Set the swivel bar to the desired taper, as determined by the scale, with adjusting screw "L", and retighten nuts "A", "B", and "C". These nuts should always be tight except when setting the taper. The standard taper scale is graduated in inches per foot (mm., per 100 mm., if metric) and degrees of taper, both units being shown on the same scale and indicated by the same pointer.

To engage the taper attachment, loosen the clamp screw "K" and place the clamping arm on the bed in the position shown, fixing the swivel bar to the bed by tightening nuts "E" and "D". When the taper attachment is not in use, clamp screw "K" must be tight, and the clamping arm either completely removed from the bed, or moved far enough away on the bed so that it does not interfere with the movement of the carriage. It is of particular importance that the tool be on the center line when doing taper turning. It is also advisable when the attachment is used consistently on a short job, to shift the swivel bar occasionally to more equally distribute wear.

The cross slide and taper attachment slide should move freely, but there should be no looseness or play. If chatter or non-uniform taper occurs, it is usually the result of looseness and can be corrected by adjusting the cross slide and top slide gibs and gibs "F", "G" and "H" on the taper attachment slides. Too tight an adjustment of the gibs can cause a binding action, which, when taper turning, will cause the slides to jump instead of moving smoothly, and has been known to cause equally divided marks on the workpiece, sometimes incorrectly attributed to gear marks.

TAILSTOCK

The tailstocks for all of the Model X Lathes use a separate rear Vee-type bedway for a guide and a separate front flat bedway for the heavy downward forces, each way being integral with the bed and hand-scraped to a bearing.

The tailstocks for the 14" and 16" Heavy Duty and the 20" Standard machines are of the rear-handwheel type as shown in Figure 1. They are locked in position on the bed by a forward and a rear clamp, the former

operated by two heavy bolts and the latter by a quick-acting lever. Thus, when the tailstock is being moved frequently as in drilling operations, the front clamp may be drawn up to bear lightly underneath the ways and the rear quick-acting clamp can be used for securing the tailstock. A crank arrangement is supplied for moving the tailstock along the bed with ease.

The standard spindle is bored to a #4 Morse taper for the 14" and 16" Heavy Duty and the 20" Standard Lathes to receive dead centers or drill shanks and is supplied with a hardened tang slot at the back end of the taper to prevent drills from slipping under cut. It is possible to remove centers or drills by running the spindle back to the end of the travel and giving the handwheel a little further turn in order that the end of the screw will loosen the center or drill from the tapered hole. A scale of inches in increments of 1/16" (cm. and mm., if metric) is provided on the front side of each standard spindle to measure the amount of spindle travel for drilling, etc. Binder jaws operated by a lever at the back of the nose end lock the spindle in any desired position.

The tailstocks for the 20" Heavy Duty and Larger Engine and Toolmaker Lathes are of the side-handwheel type as shown in Figure 2. They are locked in position on the bed by two heavy clamps, each being actuated by two large bolts. A pawl, operated by a lever at the tail end of the base, engages a rack cast into the center of the bed to back up the clamps and assures definite clamping. A crank arrangement is supplied for moving the tailstock along the bed with ease.

The standard spindle is bored to a #5 Morse taper for the 20" Heavy Duty and the 25" Standard Lathes to receive dead centers or drill shanks and is supplied with a hardened tang slot at the back of the taper to prevent drills from slipping under cut. The #6 Morse taper is used on the larger Engine Lathes. It is possible to remove centers or drills by running the spindle back to the end of the travel and then giving the handwheel a little further turn in order that the end of the screw will loosen the center or drill from the tapered hole. Binder jaws operated by a lever at the front of the nose end lock the spindle in any desired position.

The tailstock for the Oil Country Lathes is the same type of tailstock used on the 20" Heavy Duty and Larger Engine and Toolmaker Lathes except that it has added to it the two-speed drilling arrangement, and counter for measuring the spindle travel in increments of .010" (cm. and mm., if metric) as shown in Figure 3. When the handwheel is pushed completely in and the lever at the top of the handwheel unit is moved to the right, one revolution of the handwheel moves the screw through one revolution. When the handwheel is pulled completely out and the lever is moved to the left, five revolutions of the handwheel moves the screw through one revolution. Thus, in the latter case, the 5:1 reduction makes it possible to feed large drills into solid stock with relative ease. The counter is so geared to the screw that it will indicate the exact travel of the spindle at all times. The winged setting knob on the left end of the counter will

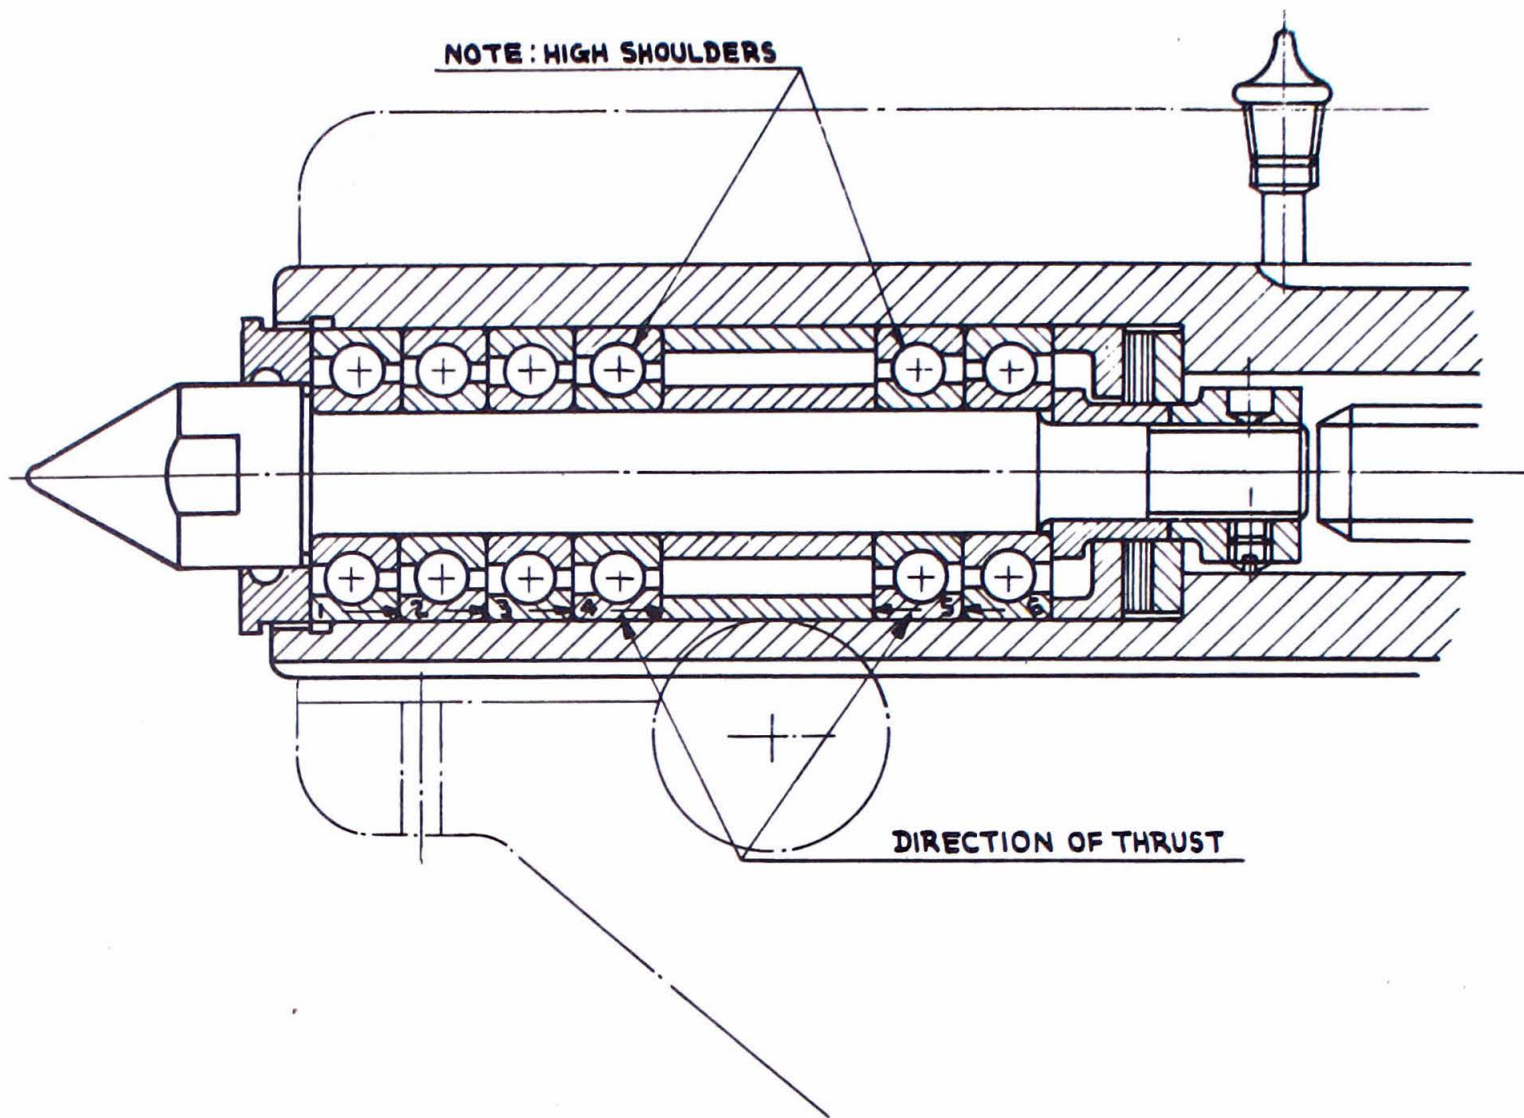


Figure 13 - Tailstock Spindle with Built-In Revolving Center.

move all the figures back to zero to start measuring the travel at any point. The two-speed drilling arrangement and counter may also be obtained at a slight extra charge as an extra item for the 20" Heavy Duty and Larger Engine and Toolmaker Lathes. A two-speed drilling attachment is also available, at extra charge, for the 14", 16" Heavy Duty and 20" Standard Lathes.

Any of the tailstocks can be furnished with a special spindle containing built-in revolving tailstock center, at extra cost, in place of or in addition to the standard spindle. The center in that case is mounted on six radial thrust preloaded ball bearings similar to that shown in Figure 13. If the spindle mounting is disassembled for any reason, it is important that the bearings be reassembled in the original position. Note that the bearings must be mounted so that the high shoulders take up the thrust in the direction shown by the arrows. All of the bearings are etched with the number and arrow for use in reassembling.

All of the tailstock bases are so arranged that it is possible to "set-over" the tailstock top, off of the center line, for doing limited taper turning. Bolts at the front and rear of the base are provided for the adjustment and a scale at the right end is used to measure the "set over".

THREAD AND FEED MECHANISM

20" HEAVY DUTY AND LARGER ENGINE LATHES AND ALL OIL COUNTRY LATHES

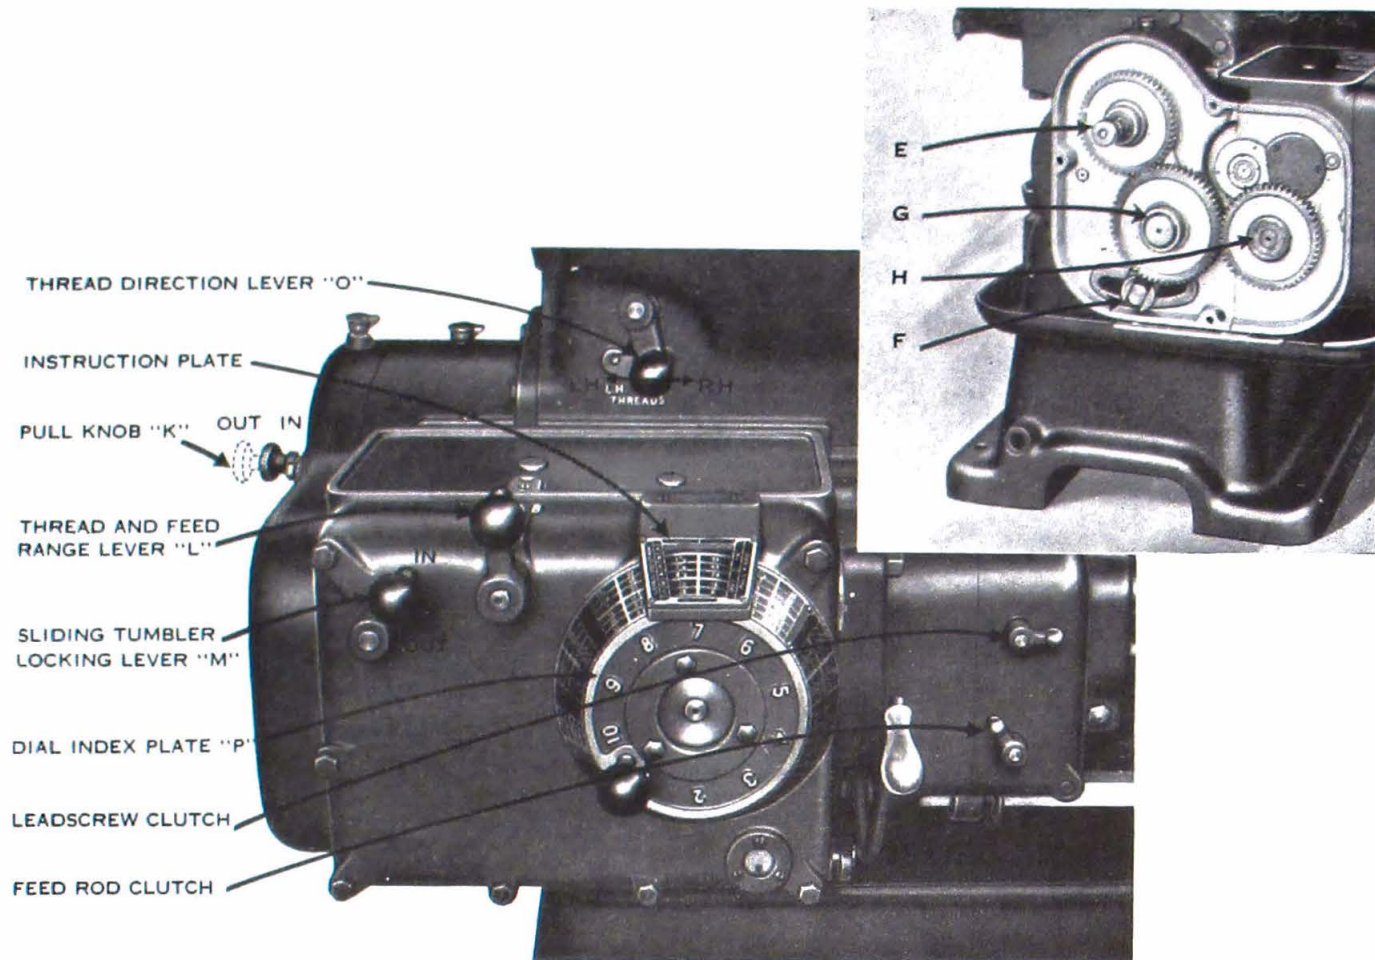


Figure 14-E Quick Change Gear Box and End Gearing

Fig. 14-E illustrates the totally enclosed quick change gear box and end gearing for the 20" Heavy Duty and larger Engine Lathes and for the Large Hole in Spindle Oil Country Lathes.

The direction of rotation of the leadscrew and feed rod can be controlled by positioning the Thread Direction Lever "O" which shifts a multiple-tooth clutch in the thread and feed train inside the headstock. When feeding, Lever "O" is placed in either the "R.H." or "L.H." position and left there. The direction of feed, both cross and longitudinal, is controlled by the Feed Direction Lever on the apron which shifts the double bevel gear in the apron. When chasing threads, Lever "O" is placed in either the "R.H." or "L.H." position, depending upon whether a right-hand or left-hand thread is to be chased.

The Sliding Tumbler Locking Lever "M" must be dropped to the "Out" position before it is possible to revolve the Dial Index Plate "P" to select the proper thread or feed. The lever is re-engaged after the proper thread or feed has been selected. Pull Knob "K" must be positioned "In" or "Out" according to the instructions shown on the Instruction Plate for the particular thread or feed desired. Thread and Feed Range Lever "L" must also be set to the indicated position in accordance with instructions on the Instruction Plate. For the "A" position, move the lever to the center and pull out. For the "B" or "C" positions, move the lever in and then throw to the right or left as required.

The Leadscrew and Feed Rod Clutches are manually operated by the small levers at the right end of the quick change gear box. When chasing threads, the Leadscrew Clutch should be engaged and the Feed Rod Clutch disengaged. When feeding, the Feed Rod Clutch should be engaged and the Leadscrew Clutch disengaged.

Adjustable automatic carriage stops are provided to control the longitudinal travel of the carriage in either direction when feeding only, and are completely inoperable when thread chasing operations are being performed. The square shaft running along the front of the bed has for its primary purpose the starting and stopping of the lathe by means of the rotary movement imparted by the control levers at the headstock and apron. In addition, however, it has an end movement by means of which the carriage travel, while feeding, can be automatically stopped. There are two dogs, one for each direction of carriage travel, which can be adjusted along the shaft for any desired length of travel. The carriage feeding against either of the dogs automatically disengages the Feed Rod Clutch at the left end of the feed rod, thus stopping the carriage. After the longitudinal feed is disengaged by either stop during feeding operations, a slight movement of the carriage in the opposite direction by means of the apron handwheel re-engages the clutch and the lathe is again ready for power feed. The longitudinal feed control lever on the apron must be disengaged before re-engaging the clutch. During thread chasing operations, the carriage is stopped either by disengaging the half nuts, or by stopping the entire machine with one of the levers on the square shaft.

CAUTION: When thread chasing, the automatic carriage stops must be loose on the square shaft and moved out of the way. The safety stop which limits the total carriage travel toward the head end of the lathe, is also inoperable when thread chasing operations are being performed.

A thread indicator, which is furnished only on lathes equipped with an English leadscrew, is attached to the right side of the carriage. When chasing threads which can be picked up by the thread indicator, the half nuts can be opened at the end of each cut and the carriage quickly returned by hand. It can be used for picking up all even, uneven, one-half, or one-quarter English threads. For even threads, (2, 4, 6 etc.) close the half nuts at any line on the dial. For uneven threads (3, 5, 7 etc.) close the half nuts at any numbered line. For half threads ($5\frac{1}{2}$, $6\frac{1}{2}$, $11\frac{1}{2}$ etc.) close the half nuts at any one-quarter revolution. For quarter threads ($2\frac{1}{4}$, $2\frac{3}{4}$, $3\frac{1}{4}$ etc.) close the half nuts at any one-half revolution. The indicator can be left engaged with the leadscrew at all times even when the leadscrew is not revolving and must always be kept engaged when in use.

These Engine and Oil Country Lathes are regularly furnished with an English leadscrew for obtaining the standard range of threads and feeds shown in Table No. 1-E. In addition, provision is made for the application of special gears, furnished at extra cost and only when ordered, making it possible to obtain odd threads, metric leads, or other special ranges of threads, leads and feeds. The following sections outline the various possibilities:

STANDARD RANGE OF THREADS AND FEEDS

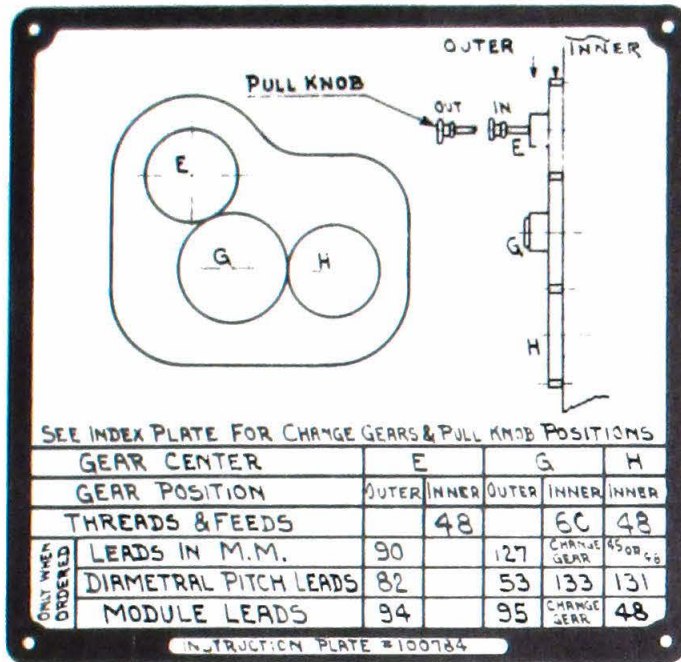


Table No. 1-E shows the standard threads and feeds obtainable. By referring to Figures 14-E and 15-E, it will be noted that 48 T gears are mounted on centers "E" and "H" and a 60 T gear on center "G".

Figure 15-E Instruction Plate

THREADS PER INCH

Example: Required to chase 3 threads per inch. Set Thread Direction Lever "O" to either "R.H." or "L.H." depending upon whether a right-hand or left-hand thread is to be chased. Drop Sliding Tumbler Locking Lever "M" to the "Out" position and turn the Dial Index Plate "P" until the desired thread appears in the Instruction Plate Window. Re-engage Lever "M" by lifting to "In" position. Move Pull Knob "K" to the "In" position and set the Range Lever "L" to "B" as indicated on the Instruction Plate. Power is transmitted to the carriage by engaging the half nuts properly with reference to the Thread Indicator. It is advisable to keep the Feed Direction Lever on the apron in the central neutral position when chasing threads.

	INDEX DIAL POSITION										LEVER	PULL KNOB	
	1	2	3	4	5	6	7	8	9	10			
THREADS PER INCH	1	1 1/8	1/4	1 3/8	1 7/16	1/2	1 5/8	1 3/4	1 7/8	2	A	IN	
	2	2/4	2 1/2	2 3/4	2 7/8	3	3 1/4	3 1/2	3 3/4	4	B		
	4	4 1/2	5	5 1/2	5 3/4	6	6 1/2	7	7 1/2	8	C		
	8	9	10	11	11 1/2	12	13	14	15	16	A		
	16	18	20	22	23	24	26	28	30	32	B		OUT
	32	36	40	44	46	48	52	56	60	64	C		
FEED IN THOUSANDTHS	160	142	128	116	110	106	98	92	85	80	A	IN	
	80	71	64	58	55	53	49	46	42	40	B		
	40	36	32	29	27	26	24	23	21	20	C		
	20	18	16	14.5	13.6	13	12	11.5	10.5	10	A		
	10	9	8	7.2	6.8	6.5	6	5.7	5.3	5	B		OUT
	5	4.5	4	3.6	3.4	3.3	3	2.8	2.6	2.5	C		
	1	2	3	4	5	6	7	8	9	10			

Table 1-E Standard Threads and Feeds

FEEDS IN THOUSANDTHS PER REVOLUTION OF SPINDLE

Example: Required to obtain a feed of .012" per revolution. Set Thread Direction Lever "O" to "R.H." position. For feeding toward the headstock or toward the center of the lathe, the Feed Direction Lever on the apron must then be in the lower position, and vice versa. Drop the Sliding Tumbler Locking Lever "M" to "Out" and turn the Dial Index Plate "P" until the desired feed appears in the Instruction Plate Window. Re-engage Lever "M" by lifting to "In" position. Move Pull Knob "K" to "Out" position and set the Range Lever "L" to "A" as indicated on the Instruction Plate. Power is transmitted to the cross slide or carriage by engaging the cross or longitudinal feed at the front of the apron.

LEADS OBTAINABLE WITH SPECIAL GEARS

METRIC LEADS

LEADS IN MILLIMETERS						100792
PULL KNOB	CHANGE GEAR	C	B	A	LEVER	
OUT	48/48	0.45	0.90	1.80	3	INDEX DIAL POSITION
	50/45	0.50	1	2	3	
	48/48	0.5625	1.125	2.25	1	
	60/45	0.60	1.20	2.40	3	
	50/45	0.625	1.25	2.50	1	
	55/45	0.6875	1.375	2.75	1	
	60/45	0.75	1.5	3	1	
	65/45	0.8125	1.625	3.25	1	
70/45	0.875	1.75	3.5	1		
IN	50/45	4	8	16	3	
	48/48	4.5	9	18	1	
	50/45	5	10	20	1	
	55/45	5.5	11	22	1	
	60/45	6	12	24	1	
	65/45	6.5	13	26	1	
	70/45	7	14	28	1	

SEE INSTRUCTION PLATE # 100784

Table No. 2-E shows the range of metric leads obtainable when special metric translating gears, which are furnished at extra cost and only when ordered, are applied to the machine. By referring to Figure 15-E, it will be noted that in addition to the translating gears on centers "E" and "G", outer plane, it is also necessary to apply a series of change gears on centers "G" and "H", inner plane, to obtain the different ranges of metric leads.

Table 2-E Metric Leads using Metric Translating Gears

Example: Required to chase a lead of 1.5 mm. A 90 T gear is mounted on center "E" meshing with a 127 T gear mounted on center "G", outer plane. On the inner plane, a 60 T gear is mounted on center "G" meshing with a 45 T gear on center "H". Set Thread Direction Lever "O" to either "R.H." or "L.H." depending upon whether a right-hand or left-hand lead is to be chased. Drop Sliding Tumbler Locking Lever "M" to "Out" position and turn Dial Index Plate "P" to No. 1 position as shown in Table No. 2-E. Re-engage Lever "M" by lifting to "In" position. Move Pull Knob "K" to "Out" position and set Range Lever "L" to "B" position. Power is transmitted to the carriage by engaging the half nuts. Since it is not possible to use the thread indicator in this case to pick up the lead for each successive pass of the tool, it is necessary to reverse the lathe carriage with the half nuts closed by means of the mechanical reverse to the spindle.

DIAMETRAL PITCH LEADS

Table No. 3-E shows the range of diametral pitch leads obtainable when special translating gears, which are furnished at extra cost and only when ordered, are applied to the machine. The leads in inches, that can be obtained as shown in Table No. 3-E are those that are equal to the circular pitches of gears of the given diametral pitches. Thus a worm or hob can be chased for a

DIAMETRAL PITCH LEADS PAS DIAMETRAL PITCH			DIAMETRAL PITCH SPOEDEN DIAMETRAL PITCH STEIGINGEN			INDEX DIAL POSITION POSITION DU TABLEAU PILOTTANT STAND VAN DRAAITABEL STELLINGEN DER DRAAITABELLE
A	B	C	A	B	C	
2	4	8	16	32	64	1
2½	4½	9	18	36	72	2
2½	5	10	20	40	80	3
2¾	5½	11	22	44	88	4
2¾	5¾	11½	23	46	92	5
3	6	12	24	48	96	6
3¼	6½	13	26	52	104	7
3½	7	14	28	56	112	8
3¾	7½	15	30	60	120	9
4	8	16	32	64	128	10

SEE INSTRUCTION PLATE VOIR INSTRUCTIONS DU TABLEAU
ZIE AANWIZINGEN TABEL SIEHE ANLEITUNGSTAFEL

108404

certain diametral pitch directly as given. All of the diametral pitch leads shown can be obtained with an 82 T gear on Center "E" meshing with a 53 T gear on Center "G", outer plane. On the inner plane, a 133 T gear on Center "G" meshes with a 131 T gear on Center "H" as shown in Figure 15-E. The machine is set up exactly as that described for setting up the machine to cut standard English Threads per inch. The correct position for the Dial Index Plate "P" is determined from the index dial position indicated in Table No. 3-E, as well as the positions for

Table 3-E Diametral Pitch Leads

the Pull Knob "K" and Range Lever "L". Since it is not possible to use the thread indicator in this case, to pick up the lead for each successive pass of the tool, it is necessary to reverse the lathe carriage with the half nuts closed by means of the mechanical reverse to the spindle.

MODULE LEADS

Table No. 4-E shows the range of module leads obtainable when special translating and change gears, furnished at extra cost and only when ordered, are applied to the machine. The leads in millimeters, that can be obtained as shown in Table No. 4-E are those that are equal to the circular pitches of gears of the

MODULE LEADS MODULE SPOEDEN		PAS MODULES MODUL STEIGINGEN			INDEX DIAL POSITION POSITION DU TABLEAU PILOTTANT STAND VAN DRAAITABEL STELLINGEN DER DRAAITABELLE
PULL-KNOB BOUTON STRIJS TUKKNOP ZUGKNOPF	CHANGE GEARS BOUC DE RECHANGE WISSELWIJZE WECHELE, PAD	C	B	A	
OUT TIRÉ UIT AUS	54	3/16	3/8	3/4	6
	60	1/4	1/2	1	3
	60	5/16	5/8	1 1/4	1
IN POUSSÉ IN EIN	54	1/2	3	6	6
	42	3/4	3 1/2	7	1
	60	2	4	8	3
	54	2 1/4	4 1/2	9	1
	60	2 1/2	5	10	1
66	2 3/4	5 1/2	11	1	

SEE INSTRUCTION PLATE VOIR INSTRUCTIONS DU TABLEAU
ZIE AANWIZINGEN TABEL SIEHE ANLEITUNGSTAFEL

108403

given modules in millimeters. Thus a worm or hob can be chased for a certain module in the metric system directly as given. It will be noted by referring to Figure 15-E and Table No. 4-E that in addition to the translating gears of 94 T on Center "E" and 95 T on Center "G", outer plane, it is also necessary to use a 48 T gear on Center "H", inner plane, and apply a series of change gears to Center "G", inner plane, to obtain the different ranges of module leads. In order to set up and operate this machine for any particular module lead, follow the same

Table 4-E Module Leads

instructions given for setting up the machine for metric leads, referring to Table No. 4-E, of course, instead of Table No. 2-E.

Leads	Thds. per Inch	Decimal Equiv. of Leads	Leads	Thds. per Inch	Decimal Equiv. of Leads	Leads	Thds. per Inch	Decimal Equiv. of Leads	Leads	Thds. per Inch	Decimal Equiv. of Leads
1/64	64	.0156	1/23	23	.0435	2/15	7-1/2	.1333	4/11	2-3/4	.3636
1/60	60	.0167	1/22	22	.0455	1/7	7	.1428	2/5	2-1/2	.4000
1/56	56	.0178	1/20	20	.0500	2/13	6-1/2	.1538	4/9	2-1/4	.4444
1/52	52	.0192	1/18	18	.0555	1/6	6	.1666	1/2	2	.5000
1/48	48	.0208	1/16	16	.0625	4/23	5-3/4	.1739	8/15	1-7/8	.5333
1/46	46	.0217	1/15	15	.0666	2/11	5-1/2	.1818	4/7	1-3/4	.5714
1/44	44	.0227	1/14	14	.0714	1/5	5	.2000	8/13	1-5/8	.6154
1/40	40	.0250	1/13	13	.0769	2/9	4-1/2	.2222	2/3	1-1/2	.6667
1/36	36	.0277	1/12	12	.0833	1/4	4	.2500	16/23	1-7/16	.6957
1/32	32	.0312	2/23	11-1/2	.0869	4/15	3-3/4	.2666	8/11	1-3/8	.7273
1/30	30	.0333	1/11	11	.0909	2/7	3-1/2	.2857	4/5	1-1/4	.8000
1/28	28	.0357	1/10	10	.1000	4/13	3-1/4	.3077	8/9	1-1/8	.8889
1/26	26	.0385	1/9	9	.1111	1/3	3	.3333	1	1	1.000
1/24	24	.0417	1/8	8	.1250	8/23	2-7/8	.3478			

Table 5-E Leads, Threads, and Decimal Equivalents

LEADS NOT ON INDEX PLATES

When it is required to cut special leads not shown on the regular index plates it is necessary to use special gears on Centers "E", "G" and "H". To obtain the correct gear ratio, it is usual to select a lead by trial from the table of leads, threads, and decimal equivalents (Table No. 5-E) and obtain the ratio by the following proportion:

$$\frac{\text{Drivers}}{\text{Driven}} = \frac{\text{Lead required}}{\text{Lead selected from table}}$$

No rule can be given for selecting a trial lead from the table. It should, however, be near the required lead, and preferably be a whole number. It must be a lead or corresponding thread regularly obtainable on the machine, but the table contains only those leads and threads.

Example: Required to cut a 5/9" lead. Select 1/2" lead from the table. Then:

$$\frac{\text{Drivers}}{\text{Driven}} = \frac{5/9}{1/2} = \frac{5 \times 2}{9 \times 1} = \frac{10}{9} = \frac{40}{36}$$

is the ratio of gears required. The 40 T gear should, therefore, be used on Center "E" and the 36 T gear on Center "H" with a suitable idler gear on the intermediate Center "G", all on the inner plane. With the correct gears on

the proper centers, the quick change gear box should then be set up for the corresponding thread to the trial lead used in the calculations.

Limitations in size of special gearing: The center distance on quadrant "F" is a fixed center distance of 6.750" and all gears meshing on Centers "E" and "G" must be of the proper size to mesh on this center distance. The maximum size O. D. gear on Center "E" is 9-5/8". The maximum size O. D. gear on Center "G" is 11-1/8". The maximum size O. D. gear on Center "H" is 8-3/4". The distances between Centers "G" and "H" are 5-9/16" minimum, 8-1/4" maximum. The minimum size gears that can be used on any of the centers must be equivalent to 24 T 8 pitch.

Compound gears: If the sizes of gears required for the particular thread or lead selected are too large, it is necessary to compound the gears. When compounding on quadrant "F" the driven gear on Center "G" meshing with the driving gear on Center "E" must be at least 2-5/8" smaller in diameter than twice the distance between the centers of gears meshing on Center "G" and "H" in order to clear the retaining hub on the cover.

CAUTION: In calculating special leads not on the index plates, no leads coarser than 2" should be used. If it is required to chase coarser leads (up to 16") an 8:1 Spindle Nose Speed Reducer, furnished at extra cost, should be used. The maximum lead of 2" (16" with Spindle Nose Speed Reducer) should not be used with a spindle speed higher than 43 R. P. M. in the standard range, or 39 R. P. M. in the high range. In a like manner, for example a lead of 1" (8" with Spindle Nose Speed Reducer) should not be used with a spindle speed higher than 88 R. P. M. in the standard range, or 77 R. P. M. in the high range.

THE WORLD TURNS
BEST ON
LODGE & SHIPLEY
LATHES

