
12 INCH 4-SPEED LATHE

• WOODWORKING • • POLISHING •

PRODUCT DATA SHEET No. 23

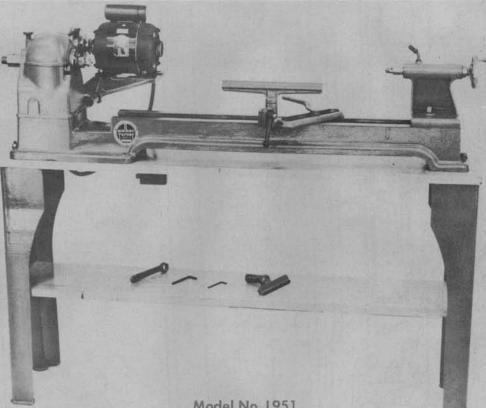

Model No. L951 on WL77X Bench

SPECIFICATIONS

- Capacity: Swing, 15-1/2" over gap, 12" over bed. • 38" between centers.
- Spindle Speeds: Four-700, 1300, 2300 and 4200 R.P.M. with 1740 R.P.M. motor.
- Spindle: 1" O.D., 5/8" hole through its length; threaded right hand on inboard end and left hand on outboard end, 12 threads per inch. No. 2 Morse taper inboard.
- Headstock: Cast iron, single V belt drive from rear mounting motor bracket. Double row pre-loaded ball bearing at spindle nose, single row at opposite end. Positive type indexing plunger.
- Tailstock: Cast iron, hand wheel feed, wedge type lock; tailstock center is automatically ejected.
- Bed: Cast iron; two ways 1-3/8" wide, machined on top, inside and bottom. Width of bed across ways 5".
- Tool Rest: Fully adjustable bracket includes permanent clamping wrench. One 12" and one 6" "T" furnished.
- Bench: (Extra) Cast iron legs, with wood top and shelf 1" thick (see accessories and drawing on back of this sheet).
- Standard Equipment: Includes rear motor bracket, one 12" and one 6" "T" rest, one spur center and one cup center, 39" V belt, and four step motor pulley 5/8" hole, less bench, motor, switch and cord.

Models: L951, for woodworking, metal spinning.

- Overall Dimensions: Height 47-1/4", width 58-1/2", depth 26".
- Shipping Weight: Machine 165 lbs. Motor 32 lbs. Bench 125 lbs.

Accessories:

Electrical Equipment:

For single phase-

KAB5E 1/2 H.P. 115/230 volt, 60 cycle, 1740 R.P.M. single phase capacitor start motor.

TS5 On-off Toggle Switch for single phase only.

No. 14 Cord and plug for single phase only.

For three phase-

- PAB5E 1/2 H.P. 220/440 volt, 60 cycle, 1740 R.P.M. three phase motor.
- HD151A On-off push button switch for three phase or single phase motor.

WL77X Bench

Note: See regular catalog for complete accessories listing.



KEARNEY & TRECKER CORPORATION NEW JERSEY, U.S.A.

